



U.S. Department  
of Transportation

**National Highway  
Traffic Safety  
Administration**

400 Seventh Street, S.W.  
Washington, D.C. 20590

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

\*\*\*    \*\*\*    \*\*\*



AUTO SAFETY HOTLINE  
(800) 424-9393  
Wash. D.C. Area 366-0123

Case Vehicle (A): 2000 Ford  
 Type: Taurus SE, 4-door sedan  
 Driver: 18-year-old male  
 CDC: 01-RFEW-3

## SITUATION

(Slide 1) It was dark, there were no streetlights in the area, the weather was clear, and (slide 2) the asphalt road surface was dry and free of defects. Case vehicle (A) was traveling south at a driver-estimated speed of 89 kph (55 mph) in the southbound lane. For an unknown reason, case vehicle (A) drifted to the right and the right wheels went off the west edge of the road surface. (Slide 3) The driver of case vehicle (A) steered back to the left and the vehicle crossed the two-lane road. (Slide 4) Case vehicle (A) then exited the east edge of the road surface, went into a counterclockwise yaw, and struck a tree with its right side at the front fender. (Slide 5) Case vehicle (A) continued to rotate counterclockwise, separated from the tree, and came to rest facing northeast. The driver was taken to a local area hospital where he was treated and released. The right-front passenger was taken to a local urgent-care facility and was treated and released.

## GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

(Slide 6) Damage to case vehicle (A) was moderate. (Slide 7) Direct damage began 12-cm rearward of the right-front bumper corner and extended 46 cm to the rear. The maximum crush was 39 cm at a point inboard of the right-front wheel.

Using the WinSMASH accident-reconstruction program, and a (slides 8, 9, 10 and 11) crush profile measured for case vehicle (A), the following impact severity was calculated:

Vehicle	Variable	Calculated Velocity Change - kph (mph)		
		Total	Longitudinal	Latitudinal
Case Vehicle (A)	delta V	30 (19)	-23 (-14)	-19 (-12)

This vehicle was equipped with a downloadable safety-restraint control module. According to the information from this module, neither occupant was belted and therefore the belt pretensioners did not fire. The airbags deployed in the first stage, and the second stage was



disposed. The longitudinal cumulative delta V was 15.3 mph, and the latitudinal cumulative delta V was 14 mph.

## **DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)**

### **Exterior**

On the right side, (slide 12) the fender was damaged, (slide 13) the right-front tire was flat, the right-front suspension was damaged, and (slide 14) the right wheelbase was reduced 10 cm.

In the front, (slide 15) the right headlight assembly, the hood, (slide 16) the right portion of the engine compartment, and (slides 17 and 18) both hood hinges were damaged. (Slide 19) The rear edge of the hood was elevated but it did not contact the windshield. (Slide 20) Rescue or towing personnel damaged the hood latch when they opened the hood to disconnect the battery. (Slide 21) The right portion of the windshield was cracked due to deformation of the cowl.

(Slide 22) There was no damage to the left side, and (slide 23) no change in the left wheelbase.

(Slide 24) There was no damage to the rear of the vehicle.

### **Interior**

This vehicle was equipped with steering-wheel and passenger frontal-impact airbags, and (slides 25, 26 and 27) both deployed in this right-side impact. There was no damage to the (slides 28 and 29) steering-wheel and (slide 30) passenger airbag module covers. There was no damage to the (slides 31 and 32) steering-wheel rim or (slide 33) spokes. There was no deflection of the steering column. (Slide 34) The adjustable brake pedal was near the rear-most position and was slightly deformed. (Slide 35) The plastic clip was broken and the plastic bar was torn out of the right sunvisor. (Slide 36) The upper instrument panel around the passenger airbag was deformed. (Slide 37) The vertical console, (slide 38) the center armrest/console, and (slide 39) the left sunvisor were scuffed. (Slide 40) The plastic mid-instrument panel trim and the knee-bolster cover were knocked loose. The following intrusions were noted and measured:

Location	Component	Distance (cm)	Direction
Center front (slide 41)	Transmission tunnel	3	up
Right front (slide 42)	Transmission tunnel	11	to right
(slide 43)	Floor	7	up

(Slides 44 and 45) There was no other interior damage. (Slide 46) The glove box door was reportedly jammed closed and had been pried open after the crash.

## OCCUPANT KINEMATICS AND INJURIES

(Slide 47) The 5-ft, 10-1/2-in, 175-lb, 18-year-old male driver was not wearing the three-point belt, (slide 48) but the frontal-impact airbag deployed in this right-side impact. (Slide 49) There was no webbing imprint on the plastic D-ring to indicate belt use at the time of the crash. (Slide 50) The belt pre-tensioner did not fire.

On impact, the driver moved to the right and forward relative to the vehicle interior. His direction of travel is indicated by the scuff marks on the (slide 51) center armrest/console, (slide 52) the vertical console, (slide 53) the twelve-volt plug-in receptacle, (slide 54) the mid instrument panel, (slide 55) the upper instrument panel, (slide 56) the left sunvisor, and (slide 57) the right sunvisor. He sustained a contusion to his head and a laceration above his right eyebrow, probably due to contact with the right sunvisor clip, as evidenced by the broken plastic clip and a scuff mark. He sustained abrasions to his right eyelid and chin, probably from contact by the driver airbag. He sustained an abrasion to his left knee, probably due to contact with the vertical console, as evidenced by a scuff mark.

(Slide 58) The 6-ft, 0-in, 150-lb, 16-year-old male, right-front passenger was not wearing the three-point belt, (slide 59) but the passenger frontal-impact airbag deployed in this right-side impact. (Slide 60) There were no witness marks on the belt webbing to indicate belt use at the time of the crash. (Slide 61) The belt pre-tensioner did not fire.

On impact, the right-front passenger moved to the right and forward relative to the vehicle interior. He sustained a contusion to the right side of his head and he had a loss of consciousness for an unknown length of time, probably due to head contact with the right A-pillar or roof siderail. He sustained a fracture to the fourth finger of his left hand, probably due to contact by

the driver or possibly from contact by the deploying airbag. (Slides 62, 63, 64 and 65) There were no contact marks on the vehicle interior from the right-front passenger.

The following tables and attached drawings (slides 66 and 67) summarize the injuries for the two occupants of case vehicle (A).

Occupant: Driver

Restraints: 3-point belt not worn; frontal-impact airbag  
deployed, pretensioner did not fire

Age: 18 years

Stature: 179 cm (5 ft, 10-1/2 in)

Gender: Male

Mass: 79 kg (175 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
Contusion, top of head	1		Right sunvisor	
Laceration, forehead above right eye	1		Right sunvisor	
Abrasion, right eyelid	1		Airbag	
Abrasion, chin	1		Airbag	
Contusion, left knee	1		Vertical console	
<u>Maximum A.I.S. Level</u>	<u>1</u>			
<u>Injury Severity Score</u>	<u>1</u>			

Occupant: Right front

Age: 16 years

Gender: Male

Restraints: 3-point belt not worn; frontal-impact airbag  
deployed, pre-tensioner did not fire

Stature: 183 cm (6 ft, 0 in)

Mass: 68 kg (150 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
Contusion, right side of head	1		Roof siderail/A-pillar	
Unconscious, unknown length of time	2		Roof siderail/A-pillar	
Fracture, fourth finger of left hand	1		Driver	Airbag
<u>Maximum A.I.S. Level</u>	<u>2</u>			
<u>Injury Severity Score</u>	<u>6</u>			

TIME

DATE OF COLLISION

      /       /              
m m d d y y y y

HOUR OF COLLISION

(24 HOUR CLOCK)

             
21 24

LOCATION

STATE:                     

STATE FIPS CODE

       
25 26

AREA

- (1) URBAN  
(2) RURAL  
(9) UNKNOWN

    
27

ENVIRONMENTAL CONDITIONS

LIMITED-ACCESS HIGHWAY

- (0) NO  
(1) YES  
(9) UNKNOWN

    
28

ROAD, TOTAL TRAFFIC LANES  
(FOR CASE VEHICLE)

- (1) 1-LANE  
(2) 2-LANES  
(3) 3-LANES  
(4) 4 OR MORE LANES  
(5) DIVIDED, 4 OR MORE LANES  
(6) PARKING LOT/DRIVEWAY  
(7) OTHER:                       
(9) UNKNOWN

    
29

INTERSECTING RD, TOTAL LANES

CHOOSE FROM ABOVE LIST, OR

- (8) NOT APPLICABLE

    
30

TYPE OF ROAD SURFACE

- (1) ASPHALT  
(2) CONCRETE  
(3) GRAVEL  
(4) MORE THAN ONE (CIRCLE EACH)  
(7) OTHER:                       
(9) UNKNOWN

    
31

ROAD DEFECTS

- (0) NO  
(1) YES  
(9) UNKNOWN

    
32

ENVIRONMENTAL CONDITIONS

CONSTRUCTION ZONE

- (0) NO  
(1) YES  
(9) UNKNOWN

    
33

ROAD ALIGNMENT  
VERTICAL PLANE

- (1) LEVEL  
(2) CREST OF HILL  
(3) SLOPE (2%)  
(4) BOTTOM OF HILL  
(9) UNKNOWN

    
34

ROAD ALIGNMENT  
HORIZONTAL PLANE

- (1) STRAIGHT  
(2) CURVE  
(3) T - SHAPED  
(4) Y - SHAPED  
(7) OTHER:                       
(9) UNKNOWN

    
35

SURFACE COVERING

- (10) DRY  
  
(21) WATER - DAMP  
(22) WATER - WET  
(23) WATER - PUDDLED  
(29) WATER - AMOUNT UNKNOWN  
  
(31) SNOW - LOOSE  
(32) SNOW - PACKED  
(39) SNOW - CONDITION UNKNOWN  
  
(41) ICE  
(51) SLUSH  
(61) SPILLED GRAVEL  
(71) OTHER:                       
(99) UNKNOWN

       
36 37

VISIBILITY LIMITATION  
(FOR CASE VEHICLE)

- (0) NONE  
(1) CLOUDY/DARK  
(2) FOG  
(3) SMOKE  
(4) WINDSHIELD CONDITION  
(5) GLARE  
(6) RAIN  
(7) OTHER:                       
(8) ICE/SNOW  
(9) UNKNOWN

    
38

VISIBILITY OBSTRUCTION  
(FOR CASE VEHICLE)

- (0) NONE  
(1) BUILDING  
(2) SIGN  
(3) VEGETATION (E.G. BUSHES, SHRUBS)  
(4) TREE  
(5) HILL OR CURVE IN ROAD  
(6) VEHICLE IN TRANSPORT  
(7) OTHER:                       
(8) PARKED VEHICLE  
(9) UNKNOWN

    
39

## ENVIRONMENTAL CONDITIONS

## SPEED LIMIT

- (0) 5-45 km/h ..... 5-25 mph  
 (1) 46-55 ..... 30  
 (2) 56-60 ..... 35  
 (3) 61-70 ..... 40  
 (4) 71-79 ..... 45  
 (5) 80-85 ..... 50  
 (6) 86-90 ..... 55  
 (7) 91-105 ..... 60  
 (8) OVER 105 ..... 65  
 (9) UNKNOWN

## PRECIPITATION

- (0) NONE  
 (1) RAIN  
 (2) SNOW  
 (3) HAIL  
 (4) FREEZING RAIN/SLEET  
 (7) OTHER: \_\_\_\_\_  
 (9) UNKNOWN

## RATE OF PRECIPITATION

- (1) LIGHT/MIST  
 (2) MODERATE  
 (3) HEAVY  
 (8) NOT APPLICABLE  
 (9) UNKNOWN

## TEMPERATURE

- (0) BELOW -15° C ..... BELOW 5° F  
 (1) -15 TO -6 ..... 5 TO 22  
 (2) -5 TO -1 ..... 23 TO 31  
 (3) 0 TO 2 ..... 32 TO 36  
 (4) 3 TO 5 ..... 37 TO 41  
 (5) 6 TO 15 ..... 42 TO 59  
 (6) 16 TO 25 ..... 60 TO 77  
 (7) 26 TO 35 ..... 78 TO 95  
 (8) OVER 35 ..... OVER 96  
 (9) UNKNOWN

## CROSSWIND

- (0) NONE  
 (1) LIGHT  
 (2) STRONG  
 (3) GUSTY & STRONG  
 (9) UNKNOWN

## LIGHT CONDITIONS

- (1) DAYLIGHT  
 (2) DAWN  
 (3) DUSK  
 (4) DARK, LIGHTED  
 (5) DARK, UNLIGHTED  
 (6) DARK, UNKNOWN IF LIGHTED  
 (9) UNKNOWN

6

40

## MECHANICAL MALFUNCTION

WAS THERE MENTION  
OF A MECHANICAL MALFUNCTION  
IN CASE VEHICLE

- (0) NO  
 (1) YES  
 (2) YES, DID NOT CONTRIBUTE  
TO ACCIDENT  
 (9) UNKNOWN

0

46

0

41

THE FOLLOWING SECTION SHOULD BE FILLED  
OUT IF A MECHANICAL MALFUNCTION IS  
RECOGNIZED OR SUSPECTED.

CIRCLE ITEMS INVOLVED. SUPPORT ANY  
ITEMS CIRCLED WITH COMMENTS.

BRAKE SYSTEM DRIVER CONTROLS

EXHAUST SYSTEM POWER TRAIN

STEERING SYSTEM FUEL SYSTEM

SUSPENSION SYSTEM VISIBILITY ITEMS

ELECTRICAL SYSTEM TIRES

THROTTLE CONTROLS UNKNOWN

OTHER: \_\_\_\_\_

COMMENTS: \_\_\_\_\_

1

44

5

45

## CRASH DETAILS

## CASE VEHICLE AND OBJECT

- (0) NO  
(1) YES  
(9) UNKNOWN

1  
47

## CASE VEHICLE ROLLOVER

- (0) NO ROLLOVER  
(1) YES, FIRST EVENT  
(2) YES, SUBSEQUENT EVENT  
(3) YES, SEQUENCE UNKNOWN  
(9) UNKNOWN

0  
48

CASE VEHICLE RAN OFF ROADWAY  
(BEFORE FIRST IMPACT)

- (0) NO  
(1) YES  
(9) UNKNOWN

1  
49

MOVING CASE VEHICLE AND  
CONTACTED MOVING VEHICLE

- (0) NO  
(1) YES  
(9) UNKNOWN

0  
50

CASE VEHICLE AND  
CONTACTED STOPPED VEHICLE

- (0) NO  
(1) YES  
(9) UNKNOWN

0  
51

STOPPED CASE VEHICLE AND  
CONTACTED VEHICLE

- (0) NO  
(1) YES  
(9) UNKNOWN

0  
52

TOTAL NUMBER  
OF VEHICLES CONTACTED  
BY CASE VEHICLE IN CRASH

- (8) 8 OR MORE  
(9) UNKNOWN

0  
53

ANY FIRE IN THIS CRASH  
(NOT JUST CASE VEHICLE)

- (0) NO  
(1) YES  
(9) UNKNOWN

0  
54

HIGHEST POLICE INJURY  
SEVERITY CODE IN CRASH  
(NOT JUST CASE VEHICLE)

- (0) O - NO INJURY  
(1) C - POSSIBLE INJURY  
(2) B - NON-INCAPACITATING INJURY  
(3) A - INCAPACITATING INJURY  
(4) K - FATAL  
(5) INJURED, SEVERITY UNKNOWN  
(6) DIED PRIOR TO ACCIDENT  
(7) NON-FATAL INJURY  
SEVERITY UNKNOWN  
(9) UNKNOWN

3  
55

## DRIVER IMPAIRMENT

DRIVER ALCOHOL INVOLVEMENT  
(CASE VEHICLE)

- (0) NONE  
(1) YES  
(9) UNKNOWN/NOT REPORTED/  
NO DRIVER

0  
56

DRIVER ALCOHOL BAC  
(CASE VEHICLE)

- (80) NO TEST  
(90) CHEMICAL TESTS, NO RESULTS  
(95) AUTOPSY, NO RESULTS  
(99) UNKNOWN

80  
57 58

WAS THERE MENTION OF DRIVER  
IMPAIRMENT FOR CASE VEHICLE?

- (0) NO  
(1) YES  
(9) UNKNOWN

0  
59

## LIST IMPAIRMENTS MENTIONED:

---



---



---

## POST - CRASH DETAIL

MANNER CASE VEHICLE  
LEFT SCENE

- (1) DRIVEN  
(2) TOWED DUE TO DAMAGE  
(3) TOWED, NOT DUE TO DAMAGE  
(4) TOWED, REASON UNKNOWN  
(9) UNKNOWN

2  
60



# ACCIDENT SCHEMATIC


ACCIDENT DESCRIPTION: Case vehicle (A) was traveling south  
and the right wheels went off the west edge of  
the road surface. Case vehicle (A) then veered left  
went across the road, went into a yaw and struck a tree with its  
right-front.

CASE VEHICLE (A): 2000 Ford Taurus  
 OTHER VEHICLE (B): \_\_\_\_\_  
 THIRD VEHICLE (C): \_\_\_\_\_

G-14



NORTH

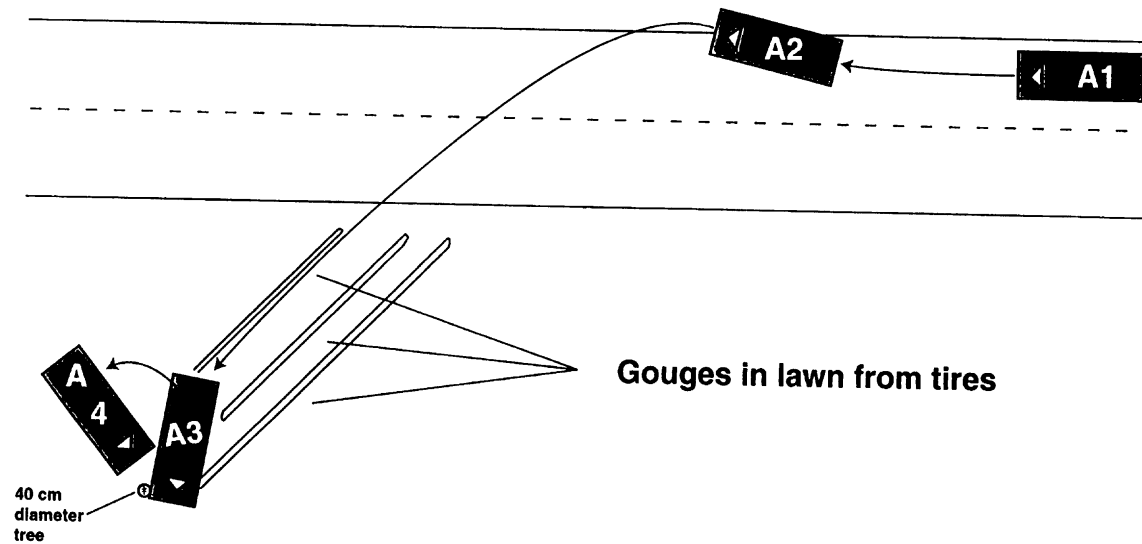

Duplicate columns 1-8  
from the previous card.

Module Q V Format Q 4  
9 10 11 12

OTHER VEHICLE OV-1

MAKE: \_\_\_\_\_  
MODEL: \_\_\_\_\_ NOT APPLICABLE

CARGO: \_\_\_\_\_

VIN

13

29

MANUFAC/BODY CODE

30

34

MAKE/MODEL CODE

38

MODEL YEAR

39

42

VEHICLE MASS (kg)

43

48

IF SEPARATE REPORT WAS MADE,  
GIVE VEHICLE NUMBER

NUMBER OF OCCUPANTS  
(ENTER 9'S IF UNKNOWN)

51

TRAVELING SPEED (km/h)

54

- (000) PARKED OR STOPPED
- (995) JUST STARTING UP
- (996) BACKING UP
- (997) SPEED NOT EXCESSIVE (BUT UNKNOWN)
- (998) SPEED EXCESSIVE (BUT UNKNOWN)
- (999) UNKNOWN

HIGHEST POLICE INJURY SEVERITY  
CODE FOR THIS VEHICLE

- (0) O - NO INJURY
- (1) C - POSSIBLE INJURY
- (2) B - NON-INCAPACITATING INJURY
- (3) A - INCAPACITATING INJURY
- (4) K - FATAL
- (5) INJURED, SEVERITY UNKNOWN
- (6) DIED PRIOR TO ACCIDENT
- (7) NON-FATAL INJURY  
SEVERITY UNKNOWN
- (8) UNOCCUPIED VEHICLE  
(NOT APPLICABLE)
- (9) UNKNOWN

55

#### VEHICLE TYPE

##### PASSENGER VEHICLE

- (02) LARGE
- (03) LIMOUSINE
- (17) PICKUP CAR
- (20) UNKNOWN PASSENGER VEHICLE BODY
- (24) SUB-MINI
- (25) MINI
- (26) SUB-COMPACT
- (27) COMPACT
- (28) INTERMEDIATE
- (29) FULL

56

57

##### MULTIPURPOSE PASSENGER VEHICLE

- (14) SMALL UTILITY (WHEELBASE LESS THAN 107".  
E.G. JEEP, BRONCO)
- (15) LARGE UTILITY (WHEELBASE MORE THAN 107".  
E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (17) PICKUP CAR WITH CANOPY/SHELL COVER
- (21) MOTOR HOME
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (23) PICKUP CAR WITH SLIDE-IN CAMPER
- (31) CHASSIS-MOUNTED CAMPER

##### TRUCK

- (11) VAN
- (12) PICKUP TRUCK
- (13) UNKNOWN LIGHT TRUCK
- (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (30) UNKNOWN TRUCK TYPE
- (31) CHASSIS-MOUNTED CAMPER
- (33) DELIVERY VAN (WALK-IN)
- (34) STRAIGHT TRUCK
- (35) TRUCK-TRACTOR (BOBTAIL)
- (36) CHASSIS-CAB
- (37) UNKNOWN HEAVY TRUCK
- (38) TRACTOR & SEMI-TRAILER (SEMI)
- (39) TRUCK (OR SEMI) & FULL TRAILER(S)

##### BUS

- (40) UNKNOWN BUS TYPE
- (41) SCHOOL BUS
- (42) INTERCITY BUS (BETWEEN CITIES)
- (43) TRANSIT BUS (INTRACITY)
- (44) STREETCAR (ON TRACKS)

- (68) TRAIN (CARS)
- (69) LOCOMOTIVE (ENGINE, SWITCHER)

(99) UNKNOWN

WHEELBASE (cm)

(999) UNKNOWN

58 59 60

- Duplicate columns 1-8  
from the previous card.

Module 0 V Format 0 2  
9 10 11 12

OTHER VEHICLE OV-2

### ORIGINAL SPECIFICATIONS

Wheelbase \_\_\_\_\_ cm

Front Overhang \_\_\_\_\_ cm  
22 24

Curb Weight \_\_\_\_\_ kg

Rear Overhang \_\_\_\_\_ cm  
25 27

Average Track Width \_\_\_\_\_ cm  
13 15

Undeformed End Width (UEW) \_\_\_\_\_ cm  
28 30

Overall Length \_\_\_\_\_ cm  
16 18

Engine Displacement \_\_\_\_\_ L  
31 32

Overall Width (OAW) \_\_\_\_\_ cm  
19 21

Engine: # of Cylinders \_\_\_\_\_  
33 34

### VEHICLE DAMAGE

NOT APPLICABLE

### FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more  
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) \_\_\_\_\_ cm  
35 37

Front-End Overlap (Percent) =  $\frac{DDL}{UEW}$  \_\_\_\_\_ %  
38 39

Vehicle Overlap (Percent) =  $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$  \_\_\_\_\_ %  
40 41

Duplicate columns 1-8  
from the previous card.

Module V D Format 0 4  
9 10 11 12

VEHICLE DESCRIPTION VD-1

MAKE: Ford  
MODEL: TAURUS SE, 4-door sedan

CARGO: \_\_\_\_\_  
\_\_\_\_\_

VIN 1 F A F P 5 5 U 5 Y G                       
13 29

MANUFAC/BODY CODE 1 2 1 2 8  
30 34

MAKE/MODEL CODE 0 2 7 5  
38

MODEL YEAR 2 0 0 0  
39 42

VEHICLE MASS (kg) 0 0 1 5 1 5  
43 48

ODOMETER (km)  
(ENTER 9'S IF UNKNOWN) 0 0 2 3 4 3  
(ENTER 8'S IF ELECTRONIC) 49 54

NUMBER OF OCCUPANTS 0 2  
(ENTER 9'S IF UNKNOWN) 56

TRAVELING SPEED (km/h) 0 8 9  
59

- (000) PARKED OR STOPPED  
(995) JUST STARTING UP  
(996) BACKING UP  
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)  
(998) SPEED EXCESSIVE (BUT UNKNOWN)  
(999) UNKNOWN

STOLEN VEHICLE

- (0) NO  
(1) YES  
(8) NOT COLLECTED  
(9) UNKNOWN

8  
62

BODY STRUCTURE

- (1) BODY & FRAME  
(2) UNITIZED  
(3) INTEGRAL-STUB FRAME  
(4) BODY & PLATFORM FRAME  
(E.G. VW BUG)  
(5) PARTIALLY UNITIZED  
(7) OTHER: \_\_\_\_\_  
(9) UNKNOWN

2  
63

TRANSMISSION

- (0) NONE  
(1) AUTOMATIC  
(2) MANUAL  
(9) UNKNOWN

1  
64

LOCATION OF TRANSMISSION  
SELECTOR LEVER

- (1) FLOOR  
(2) CONSOLE  
(3) COLUMN  
(7) OTHER: \_\_\_\_\_  
(9) UNKNOWN

3  
65

STEERING

- (1) POWER  
(2) MANUAL  
(9) UNKNOWN

1  
66

BRAKES

- (1) POWER  
(2) MANUAL  
(9) UNKNOWN

1  
67

VEHICLE TYPE

PASSENGER VEHICLE

- (11) 2-DOOR HARDTOP (NO UPPER B-PILLAR)  
(12) 2-DOOR SEDAN OR COUPE  
(ANY UPPER B-PILLAR)  
(13) 4-DOOR HARDTOP  
(14) 4-DOOR SEDAN  
(15) STATION WAGON  
(16) CONVERTIBLE  
(18) OTHER PASS. VEH.: \_\_\_\_\_  
(19) PASSENGER VEHICLE, TYPE UNKNOWN

1 4  
60 61

MULTIPURPOSE PASSENGER VEHICLE

- (21) SMALL UTILITY (E.G. JEEP, SCOUT, BRONCO)  
(22) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)  
(23) VAN, SIZE UNKNOWN  
(24) VAN, SMALL (MINI)  
(25) VAN, LARGE  
(29) MPV, TYPE UNKNOWN  
(30) MOTOR HOME

TRUCK

- (31) PICKUP TRUCK, UNKNOWN  
(32) PICKUP TRUCK, SMALL (DOWNSIZED)  
(33) PICKUP TRUCK, LARGE

(99) UNKNOWN

TYPE OF BRAKES

- (1) DRUM, ALL WHEELS
- (2) DISC, FRONT WHEELS
- (3) DISC, ALL WHEELS
- (9) UNKNOWN

1  
68

WHEELBASE (cm)  
(999) Unknown

276  
76 77 78

BRAKE ANTI-LOCK DEVICE

- (0) NONE INSTALLED
- (1) TWO-WHEEL
- (2) FOUR-WHEEL
- (7) EQUIPPED, UNKNOWN WHEELS
- (9) UNKNOWN

0  
69

PLASTIC ANTI-LACERATIVE  
INNER LAYER GLASS EQUIPPED

- (0) NONE
- (1) WINDSHIELD
- (2) WINDSHIELD AND SIDE
- (7) OTHER
- (9) UNKNOWN

6  
79

AIR CONDITIONING IN VEHICLE

- (0) NO
- (1) YES
- (8) NOT COLLECTED
- (9) UNKNOWN

8  
70

TYPE OF DRIVE

- (1) REAR WHEEL
- (2) FRONT WHEEL
- (3) FOUR WHEEL
- (4) ALL WHEEL DRIVE
- (9) UNKNOWN

2  
71

FIELD INVESTIGATOR INSTRUCTIONS:

1. INDICATE CRUSHED AREAS BY OUT-LINING NEW PERIMETER OF VEHICLE AND SHADING THE DAMAGED AREAS ON THE LARGE SKETCH ON PAGE VD-3. USE AS MANY SKETCHES AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.
2. ENTER THE DIMENSIONS ON THE SKETCH(ES) MEASURED TO THE POINT OF MAXIMUM PENETRATION BY THE OBJECT(S) CONTACTED. USE THE EXAMPLES BELOW AS A GUIDE.
3. ENTER THE THREE DIMENSIONS TO THE CENTER OF THE WHEELS (WHEELBASE, FRONT AND REAR OVERHANGS) ON BOTH SIDES OF THE CAR.
4. ADD OTHER DIMENSIONS AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.

EXAMPLES:

DUAL REAR WHEELS

- (0) NO
- (1) YES
- (9) UNKNOWN

0  
72

ORIGINAL TYPE  
OF RESTRAINT SYSTEM

- (1) ACTIVE BELT
- (2) PASSIVE BELT
- (3) AIRBAG
- (4) KNEE BOLSTERS
- (7) OTHER: \_\_\_\_\_
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

3  
73

EQUIPPED WITH ROLL BAR

- (0) NO
- (1) YES
- (9) UNKNOWN


0  
74

TYPE OF ROOF


- (0) NONE
- (1) SOLID
- (2) T-TOP CLOSED
- (3) T-TOP OPEN
- (4) SUN ROOF CLOSED
- (5) SUN ROOF OPEN
- (6) CONVERTIBLE CLOSED
- (7) CONVERTIBLE OPEN
- (8) OTHER: \_\_\_\_\_
- (9) UNKNOWN

1  
75


FRONT OR REAR

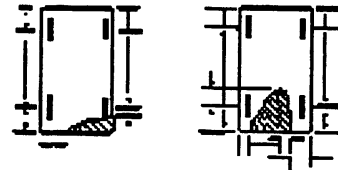

SIDE

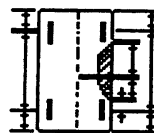

ROOF (REFERENCE TO  
TOP OF DOOR SILL  
OR WINDOW SILL)



Duplicate columns 1-8  
from the previous card.

Module V D Format 0 2  
9 10 11 12


# VEHICLE DESCRIPTION VD-3

## ORIGINAL SPECIFICATIONS

Wheelbase	<u>276</u> cm	Front Overhang	<u>1</u> <u>0</u> <u>6</u> cm
			22 24
Curb Weight	<u>1515</u> kg	Rear Overhang	<u>1</u> <u>2</u> <u>1</u> cm
			25 27
Average Track Width	<u>1</u> <u>5</u> <u>7</u> cm	Undeformed End Width (UEW)	<u>1</u> <u>5</u> <u>0</u> cm
	13 15		28 30
Overall Length	<u>5</u> <u>0</u> <u>2</u> cm	Engine Displacement	<u>3</u> <u>0</u> L
	16 18		31 32
Overall Width (OAW)	<u>1</u> <u>8</u> <u>5</u> cm	Engine: # of Cylinders	<u>0</u> <u>6</u>
	19 21		33 34

## VEHICLE DAMAGE

MEASUREMENTS IN CENTIMETERS

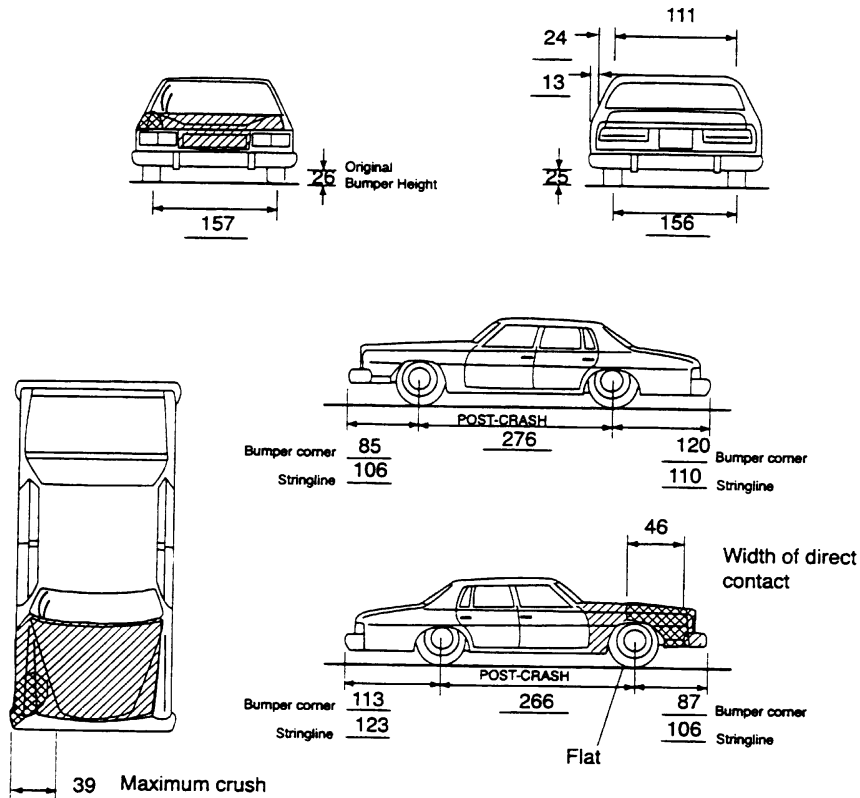

## FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more  
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) 9 9 9 cm

35 37

Front-End Overlap (Percent) =  $\frac{DDL}{UEW}$  9 9 %

38 39

Vehicle Overlap (Percent) =  $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$  9 9 %

40 41

Duplicate columns 1-8  
from the previous card.

Module D A Format 0 2  
9 10 11 12

DAMAGE DA-1

PRIMARY	CASE VEHICLE PRIMARY CDC	CONTACTED VEHICLE ASSOCIATED CDC
EVENT NUMBER	<u>1</u> 13	<i>Tree</i>
IMPACT SPEED (km/h)	<u>999</u> 14 15 16	<u>998</u> 35 36 37
ESTIMATED BY	<u>1</u> 17	<u>8</u> 38
CRUSH (cm)	<u>039</u> 18 19 20	<u>998</u> 39 40 41
CDC #1	<u>01-RFEW-3</u> 21 27	<u>98-00000-0</u> 42 48
CDC #2	<u>98-00000-0</u> 28 34	<u>98-00000-0</u> 49 55

Duplicate columns 1-8  
from the previous card.

Module D A Format 0 3  
9 10 11 12

SECONDARY	CASE VEHICLE SECONDARY CDC	CONTACTED VEHICLE ASSOCIATED CDC
EVENT NUMBER	<u>      </u> 13	
IMPACT SPEED (km/h)	<u>      </u> <u>      </u> <u>      </u> 14 15 16	<u>      </u> <u>      </u> <u>      </u> 35 36 37
ESTIMATED BY	<u>      </u> 17	<u>      </u> 38
CRUSH (cm)	<u>      </u> <u>      </u> <u>      </u> 18 19 20	<u>      </u> <u>      </u> <u>      </u> 39 40 41
CDC #1	<u>      </u> <u>      </u> <u>      </u> <u>      </u> <u>      </u> <u>      </u> 21 27	<u>      </u> <u>      </u> <u>      </u> <u>      </u> <u>      </u> <u>      </u> 42 48
CDC #2	<u>      </u> <u>      </u> <u>      </u> <u>      </u> <u>      </u> <u>      </u> 28 34	<u>      </u> <u>      </u> <u>      </u> <u>      </u> <u>      </u> <u>      </u> 49 55

## CODES

### EVENT NUMBER

(8) NOT APPLICABLE  
(9) UNKNOWN

### IMPACT SPEED

(998) NOT APPLICABLE  
(999) UNKNOWN

### IMPACT SPEED ESTIMATOR

(1) INVESTIGATOR  
(2) DRIVER  
(3) POLICE  
(4) "CRASH" PROGRAM  
(5) OTHER COMPUTER PROGRAM  
SPECIFY: \_\_\_\_\_  
(7) OTHER: \_\_\_\_\_  
(8) NOT APPLICABLE  
(NO VEHICLE/NO IMPACT)

### CRUSH

(998) NOT APPLICABLE  
(NO VEHICLE/DAMAGE)  
(999) UNKNOWN

### CDC

(9800000) NOT APPLICABLE  
(9900000) UNKNOWN

Duplicate columns 1-8  
from the previous card.Module D A Format 0 1  
9 10 11 12

DAMAGE DA-2

## MAXIMUM SHEET METAL CRUSH

(cm) (999) UNKNOWN

FRONT 0 0 0  
13 15RIGHT SIDE 0 3 9  
16 18REAR 0 0 0  
19 21LEFT SIDE 0 0 0  
22 24ROOF 0 0 0  
25 27OTHER 0 0 0  
28 30CHRONOLOGICAL SEQUENCE  
OF DAMAGE/INJURY PRODUCING CRASH EVENTS  
FOR CASE VEHICLENOTE: IF CHRONOLOGICAL ORDER  
IS UNKNOWN, EVENT  
ORDER IS OPTIONAL.DO YOU KNOW THIS TABLE  
TO BE IN CHRONOLOGICAL ORDER? 1

31

(0) NO  
(1) YES

EVENT NUMBER	IMPACT LOCATION (1) ON ROADWAY (2) SHOULDER/MEDIAN/GORE (3) ON ROADSIDE (4) OUTSIDE ROADSIDE RIGHT-OF-WAY (5) OTHER (6) OFF ROADWAY, LOC. UNK. (9) UNKNOWN	IMPACT CONFIGURATION FOR CODES, SEE TABLE ON PAGE DA-3.	OBJECT/VEHICLE CONTACTED FOR CODES, SEE TABLE ON PAGE DA-4.
# 1	<u>4</u> 32	<u>47</u> 34	<u>77</u> Tree 36
#2	<u>      </u> 37	<u>      </u> 39	<u>      </u> 41
#3	<u>      </u> 42	<u>      </u> 44	<u>      </u> 46
#4	<u>      </u> 47	<u>      </u> 49	<u>      </u> 51
#5	<u>      </u> 52	<u>      </u> 54	<u>      </u> 56
#6	<u>      </u> 57	<u>      </u> 59	<u>      </u> 61
#7	<u>      </u> 62	<u>      </u> 64	<u>      </u> 66



CODES FOR  
IMPACT CONFIGURATIONFRONT OF CASE VEHICLE

- (11) AND FRONT OF CONTACTED VEHICLE
- (13) AND SIDE OF CONTACTED VEHICLE
- (14) AND REAR OF CONTACTED VEHICLE
- (16) ENDSWIPED BY CONTACTED VEHICLE
- (17) AND OBJECT
- (19) AND UNKNOWN OTHER VEHICLE CONFIGURATION

LEFT SIDE OF CASE VEHICLE

- (21) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (22) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (23) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (24) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (25) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (26) SIDESWIPED BY CONTACTED VEHICLE
- (27) AND OBJECT
- (29) AND UNKNOWN OTHER VEHICLE CONFIGURATION

REAR OF CASE VEHICLE

- (31) AND FRONT OF CONTACTED VEHICLE
- (33) AND SIDE OF CONTACTED VEHICLE
- (34) AND REAR OF CONTACTED VEHICLE
- (36) ENDSWIPED BY CONTACTED VEHICLE
- (37) AND OBJECT
- (39) AND UNKNOWN OTHER VEHICLE CONFIGURATION

RIGHT SIDE OF CASE VEHICLE

- (41) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (42) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (43) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (44) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (45) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (46) SIDESWIPED BY CONTACTED VEHICLE
- (47) AND OBJECT
- (49) AND UNKNOWN OTHER VEHICLE CONFIGURATION

## OTHER

- (57) VEHICLE TO OBJECT
- (58) VEHICLE TO VEHICLE
- (59) VEHICLE TO VEHICLE, CONFIGURATION UNKNOWN

## ROLLOVER

- (61) LESS THAN 360°
- (62) 360° OR MORE
- (69) DETAILS UNKNOWN

## UNKNOWN

- (99) IMPACT TYPE UNKNOWN

CODES FOR VEHICLE/OBJECT CONTACTED

VEHICLE/OBJECT GROUPS

- (00) NO OBJECT
- (01) - (39) PASSENGER VEHICLE & TRUCK
- (40) - (69) OTHER VEHICLE
- (70) - (76) PEDESTRIAN & ON-ROADWAY OBJECT
- (77) - (97) OFF-ROADWAY OBJECT
- (98) OTHER (DESCRIBE)
- (99) UNKNOWN

PASSENGER VEHICLE

- (02) LARGE
- (03) LIMOUSINE
- (17) PICKUP
- (20) UNKNOWN PASSENGER VEHICLE BODY
- (24) SUB-MINI
- (25) MINI
- (26) SUB-COMPACT
- (27) COMPACT
- (28) INTERMEDIATE
- (29) FULL

SIZE	WHEELBASE
SUB-MINI	< 2286 mm (< 90")
MINI	2286 - 2412 mm (90" - 94.9")
SUB-COMPACT	2413 - 2539 mm (95" - 99.9")
COMPACT	2540 - 2666 mm (100" - 104.9")
INTERMEDIATE	2667 - 2793 mm (105" - 109.9")
FULL	2794 - 2920 mm (110" - 114.9")
LARGE	2921 - 3174 mm (115" - 124.9")
LIMOUSINE	> 3175 mm (> 125")

MULTIPURPOSE PASSENGER VEHICLE

- (11) SMALL VAN (MINI)
- (12) PICKUP
- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",  
E.G. JEEP, BRONCO)
- (15) LARGE UTILITY (WHEELBASE MORE THAN 107",  
E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (17) PICKUP CAR WITH CANOPY/SHELL COVER
- (21) MOTOR HOME
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (23) PICKUP CAR WITH SLIDE-IN CAMPER
- (31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) SMALL VAN (E.G. ECONOLINE)
- (12) PICKUP TRUCK
- (13) UNKNOWN LIGHT TRUCK
- (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (30) UNKNOWN TRUCK TYPE
- (31) CHASSIS-MOUNTED CAMPER
- (33) DELIVERY VAN (WALK-IN)
- (34) STRAIGHT TRUCK
- (35) TRUCK-TRACTOR (BOBTAIL)
- (36) CHASSIS-CAB
- (37) UNKNOWN HEAVY TRUCK
- (38) TRACTOR & SEMI-TRAILER (SEMI)
- (39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE
- (41) SCHOOL BUS
- (42) INTERCITY BUS (BETWEEN CITIES)
- (43) TRANSIT BUS (INTRACITY)
- (44) STREETCAR (ON TRACKS)

MOTORCYCLE

- (50) UNKNOWN MOTORCYCLE TYPE
- (51) 1 - 75 cc
- (52) 76 - 125 cc
- (53) 126 - 250 cc
- (54) 251 - 500 cc
- (55) 501 - 750 cc
- (56) 751 cc +
- (57) 3-WHEELS (OR WITH SIDECAR)

SPECIAL PURPOSE VEHICLE

- (60) UNKNOWN/OTHER SPECIAL VEHICLE (DESCRIBE)
- (61) SNOWMOBILE
- (62) ATV (ALL TERRAIN VEHICLE)
- (63) AMPHIBIOUS VEHICLE
- (64) FARM VEHICLE
- (65) CONSTRUCTION VEHICLE
- (66) TRAILER, PRIVATE (CAMPER)
- (67) TRAILER, COMMERCIAL (CARGO)
- (68) TRAIN (CARS)
- (69) LOCOMOTIVE (ENGINE, SWITCHER)

OBJECT

- (70) PEDESTRIAN
- (71) BICYCLIST, OTHER PEDALCYCLIST
- (72) PEDESTRIAN CONVEYANCE (E.G. PERSON RIDING  
ANIMAL, CART)
- (73) LARGE ANIMAL
- (74) FALLEN OBJECT (E.G. OBJECT DISLODGED FROM  
OTHER VEHICLE, FALLEN TREE, ROCKS)
- (75) ROCKS
- (76) CONSTRUCTION EQUIPMENT (EXCLUDING (65))
- (77) SIGN POST, UTILITY POLE, TREE
- (78) DITCH
- (79) EMBANKMENT, SNOWBANK, RR TRACKS RR X
- (80) GROUND (ROLLOVER ONLY)
- (81) CURB (DAMAGE PRODUCING IMPACTS ONLY)
- (82) CULVERT
- (83) FENCE
- (84) HYDRANT, SHORT POST, STUMP
- (85) SMALL POST/TREE, RURAL MAIL BOX, MILE  
MARKER, DELINEATOR
- (86) BUILDING
- (87) PIER, PILLAR, BRIDGE SUPPORT
- (88) ABUTMENT, RETAINING WALL
- (89) BRIDGE RAIL
- (90) GUARD RAIL, LEADING SECTION
- (91) GUARD RAIL, MIDDLE OR UNKNOWN
- (92) GUARD RAIL, TRAILING SECTION
- (93) GUARD POST (TIMBER, METAL, CONCRETE)
- (94) CABLE, FENCE BARRIER
- (95) CONCRETE BARRIER (MEDIAN)
- (96) IMPACT ATTENUATOR
- (97) BREAKAWAY FEATURES



Duplicate columns 1-8  
from the previous card.

Module C R Format 0 1  
9 10 11 12

# CRASH RECONSTRUCTION CR-1

for  $\Delta V$

	CASE VEHICLE PRIMARY IMPACT		CASE VEHICLE SECONDARY IMPACT	
	CASE VEHICLE	CONTACTED VEHICLE	CASE VEHICLE	CONTACTED VEHICLE
EVENT NUMBER	<u>1</u> 13	<u>Tree</u>	<u>      </u> 47	
$\Delta V$ (km/h) TOTAL	<u>030</u> 14 15 16	<u>8—</u> 32 33 34	<u>      </u> 48 49 50	<u>      </u> 66 67 68
LONGITUDINAL*	<u>-023</u> 17 20	<u>8—</u> 35 38	<u>      </u> 51 54	<u>      </u> 69 72
LATERAL*	<u>-019</u> 21 24	<u>8—</u> 39 42	<u>      </u> 55 58	<u>      </u> 73 76
*NOTE: THESE $\Delta V$ COMPONENTS MUST INCLUDE SIGN.				
EXAMPLES: 10 km/h = $\pm 010$ -7 km/h = $-007$				
ENERGY DISSIPATED BY CRUSH (kj)	<u>0056</u> 25 28	<u>8—</u> 43 46	<u>      </u> 59 62	<u>      </u> 77 80
RECONSTRUCTION				
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>22</u> 29 30		<u>      </u> 63 64	
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL				
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL				
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL				
NOT RECONSTRUCTED BECAUSE				
(02) INSUFFICIENT DATA				
(03) EXCESSIVE UNDERRIDE/ OVERRIDE				
(04) ROLLOVER				
(05) VAULTING				
(06) OTHER TRAVEL IN MORE THAN ONE PLANE				
(07) NON-HORIZONTAL FORCE				
(08) SIDESWIPE-TYPE DAMAGE				
(09) YIELDING OBJECT				
(10) OTHER: _____				
(11) AT LEAST ONE VEHICLE BEYOND SCOPE				
(12) OTHER VEHICLE NOT INSPECTED				
MODE				
(1) CDC ONLY				
(2) CDC & DETAILED DAMAGE	<u>2</u> 31		<u>      </u> 65	
(3) TRAJECTORY & CDC				
(4) TRAJECTORY & CDC & DETAILED DAMAGE				
(5) NOT RECONSTRUCTED				
COMPUTER PROGRAM SPECIFY: <u>WINSMASH</u>				

Duplicate columns 1-8  
from the previous card.

Module C R Format 0 2  
9 10 11 12

# CRASH RECONSTRUCTION CR-2

for EBS

	CASE VEHICLE PRIMARY IMPACT		CASE VEHICLE SECONDARY IMPACT	
	CASE VEHICLE	CONTACTED VEHICLE	CASE VEHICLE	CONTACTED VEHICLE
EVENT NUMBER	<u>1</u> 13	<u>Tree</u>	<u>47</u>	
EBS (km/h) TOTAL	<u>030</u> 14 15 16	<u>8</u> — 32 33 34	<u>48 49 50</u>	<u>66 67 68</u>
LONGITUDINAL*	<u>-023</u> 17 20	<u>8</u> — 35 38	<u>51 54</u>	<u>69 72</u>
LATERAL*	<u>-019</u> 21 24	<u>8</u> — 39 42	<u>55 58</u>	<u>73 76</u>
*NOTE: THESE EBS COMPONENTS MUST INCLUDE SIGN.				
EXAMPLES: 10 km/h = ± 010 -7 km/h = - 007				
ENERGY DISSIPATED BY CRUSH (kj)	<u>0056</u> 25 28	<u>8</u> — 43 46	<u>59 62</u>	<u>77 80</u>
RECONSTRUCTION				
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>22</u> 29 30		<u>63 64</u>	
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL				
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL				
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL				
NOT RECONSTRUCTED BECAUSE				
(02) INSUFFICIENT DATA				
(03) EXCESSIVE UNDERRIDE/ OVERRIDE				
(04) ROLLOVER				
(05) VAULTING				
(06) OTHER TRAVEL IN MORE THAN ONE PLANE				
(07) NON-HORIZONTAL FORCE				
(08) SIDESWIPE-TYPE DAMAGE				
(09) YIELDING OBJECT				
(10) OTHER: _____				
(11) AT LEAST ONE VEHICLE BEYOND SCOPE				
(12) OTHER VEHICLE NOT INSPECTED				
MODE				
(1) CDC ONLY				
(2) CDC & DETAILED DAMAGE	<u>2</u> 31		<u>65</u>	
(3) TRAJECTORY & CDC				
(4) TRAJECTORY & CDC & DETAILED DAMAGE				
(5) NOT RECONSTRUCTED				
COMPUTER PROGRAM SPECIFY: <u>WINSMASH</u>				

Duplicate columns 1-8  
from the previous card.

Module C R Format 0 3  
9 10 11 12

# CRASH RECONSTRUCTION CR-3

- NOTES:
1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.
  2. MEASURE  $C_1$  TO  $C_6$  FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.
  3.  $D$  IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
  4. USE THE CENTER OF THE WHEELBASE AS THE CG.

CASE VEHICLE



LOCATOR

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L
1	12 cm rear of rt ft BC	12 cm rear of rt ft BC

PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other \_\_\_\_\_
- (9) Unknown

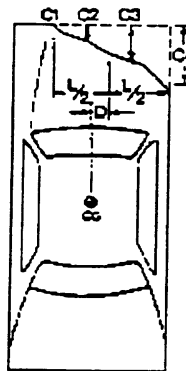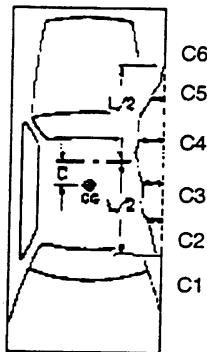

DL \_\_\_\_\_

UDL \_\_\_\_\_

FLD  
+163

## CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.

Specific Impact Number	Plane of Impact C-Measur.	Direct Damage		Field L	C <sub>1</sub>	C <sub>2</sub>	C <sub>3</sub>	C <sub>4</sub>	C <sub>5</sub>	C <sub>6</sub>	±D
		Length (DDL)	Max Crush								
1	4	46	39	60	0	39	38	31	25	0	+154
1	4	046	039	060	000	039	038	031	025	000	+154
13	14	15 16 17	18 19 20	21 22 23	24 25 26	27 28 29	30 31 32	33 34 35	36 37 38	39 40 41	42 43 44 45
2											



Duplicate columns 1-8  
from the previous card.

Module W T Format 0 1  
9 10 11 12

# WHEELS AND TIRES

WT-1

## WHEELS--DAMAGED

- (0) NO  
(1) YES  
(9) UNKNOWN

Flat -

LF 0  
13  
RF 0  
RR 0  
LR 0  
16

SIZE (NOT DOT CODE. IF UNKNOWN, USE 9'S)

LF P 2 1 5 6 0 R 1 6  
25

RF \_\_\_\_\_  
35

RR \_\_\_\_\_  
45

LR \_\_\_\_\_  
55

## TIRE TREAD TYPE

- (1) REGULAR  
(2) SNOW  
(3) SLICKS  
(4) ALL WEATHER (MS)  
(7) OTHER: \_\_\_\_\_  
(9) UNKNOWN

LF 4  
17  
RF 4  
RR 4  
LR 4  
20

## CARCASS CONSTRUCTION

- (1) BIAS  
(2) BELTED BIAS  
(3) RADIAL  
(4) ELLIPTICAL  
(5) HI PRESSURE SPARE  
(6) SPACE SAVER SPARE  
(7) OTHER: \_\_\_\_\_  
(9) UNKNOWN

LF 3  
21  
RF 3  
RR 3  
LR 3  
24

IF VEHICLE IS EQUIPPED WITH DUAL  
WHEELS, COMPLETE FOR OUTER WHEELS  
AND MAKE NOTES ON INNER WHEELS.

NOTES: \_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_



Duplicate columns 1-8  
from the previous card.

Module F T Format 0 1  
9 10 11 12

## FUEL AND FUEL TANKS FT-1

### TYPE OF PROPULSIVE FUEL

- (1) GASOLINE
- (2) DIESEL OIL
- (3) LPG
- (4) ELECTRIC
- (7) OTHER: \_\_\_\_\_
- (9) UNKNOWN

1  
13

### AUXILIARY TANK TYPE

- (1) OEM TANK
- (2) AFTER MARKET TANK
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

8  
21

### MAIN TANK LOCATION

3 2 2  
14 16

### AUXILIARY TANK LOCATION

8 8 8  
22 24

### MAIN FILLER CAP LOCATION

1 3 3  
17 19

### AUXILIARY FILLER CAP LOCATION

8 8 8  
25 27

### MAIN TANK MATERIAL

3  
20

### AUXILIARY TANK MATERIAL

8  
28

### TANK AND FILLER CAP LOCATION CODES

#### FIRST DIGIT (LONGITUDINAL)

- (1) BEHIND KICK-UP
- (2) IN KICK-UP
- (3) BETWEEN KICK-UP & COWL
- (4) FORWARD OF COWL
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

#### SECOND DIGIT (LATERAL)

- (1) LEFT OF FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) RIGHT OF FRAME
- (4) DUAL, RIGHT & LEFT TANKS
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

#### THIRD DIGIT (VERTICAL)

- (1) BELOW FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) ABOVE FRAME
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

### TANK MATERIAL CODES

- (1) STEEL
- (2) ALUMINUM
- (3) PLASTIC
- (7) OTHER
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

Duplicate columns 1-8  
from the previous card.

Module F L Format 0 1  
9 10 11 12

FUEL LEAKAGE FL-1

# DID FUEL LEAKAGE RESULT FROM A CRASH EVENT

(0) NO KNOWN LEAKAGE SKIP PAGE.

(1) YES COMPLETE PAGE.

0  
13

LEAK NUMBER	I LEAKING COMPONENT	II COMPONENT SOURCE	III TYPE OF DAMAGE	IV SEVERITY OF DAMAGE	V LOCATION OF LEAK	EVENT NUMBER
#1	<u>    </u> <u>    </u> 14 15	<u>    </u>	<u>    </u>	<u>    </u>	<u>    </u> <u>    </u>	<u>    </u> 21
#2	<u>    </u> <u>    </u> 22 23	<u>    </u>	<u>    </u>	<u>    </u>	<u>    </u> <u>    </u>	<u>    </u> 29
#3	<u>    </u> <u>    </u> 30 31	<u>    </u>	<u>    </u>	<u>    </u>	<u>    </u> <u>    </u>	<u>    </u> 37
#4	<u>    </u> <u>    </u> 38 39	<u>    </u>	<u>    </u>	<u>    </u>	<u>    </u> <u>    </u>	<u>    </u> 45
#5	<u>    </u> <u>    </u> 46 47	<u>    </u>	<u>    </u>	<u>    </u>	<u>    </u> <u>    </u>	<u>    </u> 53

## I LEAKING COMPONENT

### TANK AREA

- (11) MAIN FUEL TANK (INCLUDING VAPOR RECOVERY DOME)
- (12) AUXILIARY FUEL TANK
- (13) MAIN TANK FILLER TUBE
- (14) MAIN TANK CAP (GAS CAP)
- (15) AUXILIARY TANK FILLER TUBE
- (16) AUXILIARY TANK CAP (GAS CAP)
- (19) TANK AREA, DETAILS UNKNOWN

### DELIVERY SYSTEM

- (21) FUEL FEED LINE (MAIN TANK TO FUEL PUMP)
- (22) FUEL FEED LINE (AUXILIARY TANK TO FUEL PUMP)
- (23) FUEL RETURN LINE (FUEL PUMP TO TANK)
- (24) INLINE FUEL FILTER
- (25) FUEL LINE (PUMP TO CARBURETOR OR INJECTOR PUMP)
- (26) CARBURETOR TO INJECTOR PUMP
- (27) FUEL PUMP
- (29) DELIVERY SYSTEM, DETAILS UNKNOWN

### EVAPORATIVE EMISSION CONTROL SYSTEM

- (31) ATMOSPHERIC VENT PIPE (NON-EEC EQUIPPED)
- (32) EEC PIPE (VAPOR CANISTER TO CARBURETOR)

### EEC SYSTEM (CONTINUED)

- (33) VAPOR RECOVERY HOSES (CANISTER TO CARBURETOR)
- (34) LIQUID-VAPOR SEPARATOR (UNLESS PART OF TANK)
- (35) CANISTER
- (39) EEC SYSTEM, DETAILS UNKNOWN

- (49) ENGINE COMPARTMENT, COMPONENT UNKNOWN
- (99) COMPONENT UNKNOWN

## II COMPONENT SOURCE

- (1) OEM
- (2) AFTER MARKET
- (9) UNKNOWN

## III TYPE OF DAMAGE

- (1) DENTED/CRUSHED
- (2) PUNCTURED
- (3) RUPTURED
- (4) SEVERED/GROSS TEARS
- (5) DISCONNECTED/DEFEATED
- (9) UNKNOWN

## IV SEVERITY OF DAMAGE

- (1) MINOR
- (2) MODERATE
- (3) SEVERE
- (4) DISCONNECTED/DEFEATED
- (9) UNKNOWN

## V LOCATION OF LEAK

FIRST DIGIT  
(LONGITUDINAL LOCATION)

- (1) F, FORWARD OF COWL
- (2) P, BETWEEN COWL & REAR BULKHEAD
- (3) B, BEHIND REAR BULKHEAD
- (4) Y, F, & P
- (5) Z, P, & B
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

SECOND DIGIT  
(LATERAL LOCATION)

- (1) L, LEFT
- (2) C, CENTER
- (3) R, RIGHT
- (4) Y, LEFT CENTER (L & C)
- (5) Z, RIGHT CENTER (R & C)
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

Duplicate columns 1-8  
from the previous card.

Module F R Format 0 1  
9 10 11 12

FIRE FR-1

WAS THERE FIRE IN OR ON CASE VEHICLE?

(0) NO SKIP PAGE.

0  
13

(1) YES COMPLETE PAGE.

DID FIRE START IN CASE VEHICLE?

- (0) NO  
(1) YES  
(9) UNKNOWN

      
14

SEVERITY OF FIRE DAMAGE

- (1) MINOR  
(2) MODERATE  
(3) SEVERE  
(9) UNKNOWN

      
16

FLAME PROPOGATION RATE

- (1) RAPID/EXPLOSIVE  
(2) SLOW/MODERATE  
(9) UNKNOWN

      
15

DID AN INJURY TO CASE  
VEHICLE OCCUPANT RESULT FROM  
FIRE IN OR ON CASE VEHICLE?

- (0) NO  
(1) YES  
(9) UNKNOWN

      
17

PROVIDE NOTES IF FIRE OCCURRED.

Duplicate columns 1-8  
from the previous card.

Module E D Format 0 1  
9 10 11 12

## EXTERIOR DAMAGE

ED-1

### HOOD PERFORMANCE

FOR THE FOLLOWING, USE CODES:

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

HOOD LATCH(ES)- -RELEASED

*Prried open  
by rescue or  
towing personnel*

-DAMAGED

-JAMMED

HOOD HINGES- -LEFT, DAMAGED

-LEFT, SEPARATED  
(COMPLETE)

-RIGHT, DAMAGED

-RIGHT, SEPARATED  
(COMPLETE)

HOOD REMAINED ON VEHICLE

REAR EDGE OF HOOD- -ELEVATED

*Hood Hinge - yes*

-CONTACTED WINDSHIELD

-PENETRATED WINDSHIELD

HOOD LATCH LOCATION

- (1) FRONT OF VEHICLE
- (2) COWL AREA
- (3) SIDE
- (8) NOT APPLICABLE
- (9) UNKNOWN

### ENGINE OR TRANSMISSION MOUNT

SEPARATION (COMPLETE)

- (0) NO
- (1) YES
- (9) UNKNOWN

### STEERING COL FLEXIBLE COUPLING

FLEXIBLE COUPLING TYPE

- (0) NONE
- (1) FLEXIBLE MATERIAL
- (2) POT
- (3) SINGLE U-JOINT
- (4) DOUBLE U-JOINT
- (5) FLEXIBLE CABLE
- (6) COMBINATION OF ABOVE  
(CIRCLE EACH)
- (7) OTHER: \_\_\_\_\_
- (8) EQUIPPED, TYPE UNKNOWN
- (9) UNKNOWN, IF EQUIPPED

COUPLING-

-DAMAGED

(USE CODES  
FROM HOOD  
PERFORMANCE)

-SEPARATED  
(COMPLETE)

### ENG COMPART TELESCOPING UNIT

TYPE OF UNIT

- (00) NONE INSTALLED
- (01) - (07) SEE UNITS ON PAGE ED-2
- (88) NOT COLLECTED
- (97) OTHER: \_\_\_\_\_
- (98) EQUIPPED, TYPE UNKNOWN
- (99) UNKNOWN IF EQUIPPED

ORIGINAL LENGTH (mm)

F (OR H): \_\_\_\_\_

TELESCOPED LENGTH (mm)

G: \_\_\_\_\_

DIFFERENCE (mm)

F (OR H) - G

(IF LESS THAN 15mm, ENTER "000".)

- (888) NOT COLLECTED
- (991) NOT MEASURED/NO  
COMPRESSION
- (992) COMPRESSED, AMOUNT  
UNKNOWN
- (993) DEVICE EXTENDED
- (997) UNABLE TO BE MEASURED
- (998) NOT APPLICABLE (NOT  
EQUIPPED)
- (999) UNKNOWN

## LEFT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE  
 (9) UNKNOWN

8  
 34

## LEFT DOORS

HOW DID DOORS  
OPEN DURING COLLISION?

USE CODES:

- (0) DOOR DID NOT OPEN  
 OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION  
 (2) DOOR-LATCH SEPARATION  
 (3) LATCH-STRIKER SEPARATION  
 (4) STRIKER-PILLAR SEPARATION  
 (5) BODY DISTORTION  
 (6) COMBINATION OF ABOVE  
 (CIRCLE EACH)  
 (7) OPENED, REASON UNKNOWN

- (8) NOT APPLICABLE (NO DOOR)  
 (9) UNKNOWN

## LEFT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO  
 (1) YES  
 (4) NO SEPARATION, BUT DAMAGED  
 (8) NOT APPLICABLE (NOT EQUIPPED)  
 (9) UNKNOWN

-A-PILLAR, UPPER

0  
 35

LOWER

0  
 36

-B-PILLAR, UPPER

0  
 37

LOWER

0  
 38

-C-PILLAR, UPPER

0  
 39

LOWER

0  
 40

-D-PILLAR, UPPER

0  
 41

LOWER

8  
 42

-FRONT

0  
 43

-REAR

0  
 44

DOORS JAMMED CLOSED-

USE CODES:

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE (NO DOOR)  
 (9) UNKNOWN

-FRONT

0  
 45

-REAR

0  
 46

## EXTERIOR DAMAGE

ED-3

## REAR DOOR


## REAR DOOR TYPE

- (0) NO DOOR (INCLUDES PICKUPS)
- (1) HATCHBACK
- (2) ONE-WAY TAILGATE
- (3) TWO-WAY TAILGATE
- (4) CLAMSHELL/DISAPPEARING TAILGATE
- (5) SINGLE DOOR
- (6) DOUBLE DOOR
- (9) UNKNOWN

Hatchback



One-way



Two-way



or



Clamshell



Single door



Double door

HOW DID DOOR  
OPEN DURING COLLISION?

- (0) DOOR DID NOT OPEN

## OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION
- (2) DOOR-LATCH SEPARATION
- (3) LATCH-STRIKER SEPARATION
- (4) STRIKER-PILLAR SEPARATION
- (5) BODY DISTORTION
- (6) COMBINATION OF ABOVE  
(CIRCLE EACH)
- (7) OPENED, REASON UNKNOWN
- (8) NOT APPLICABLE (NO DOOR)
- (9) UNKNOWN

## DOOR JAMMED CLOSED

- (0) NO
- (1) YES
- (8) NOT APPLICABLE (NO DOOR)
- (9) UNKNOWN

0  
47

8  
48

8  
49

## OTHER REAR DAMAGE

WAS PARTITION TO LUGGAGE AREA  
DAMAGED DURING COLLISION?

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

0  
50

## SPARE TIRE

- (0) NO SPARE TIRE
- (1) NOT ATTACHED BEFORE COLLISION
- (2) ATTACHED, NOT SEPARATED IN COLLISION
- (3) ATTACHED, SEPARATED DUE TO COLLISION
- (8) NOT COLLECTED
- (9) UNKNOWN

8  
51

## TRAILER HITCH TYPE

- (0) NO HITCH

## BALL-AND-SOCKET TYPES

- (1) TEMPORARY FRAMEWORK (E.G. RENTAL CLAMP-ON)
- (2) BUMPER-MOUNT ONLY (E.G. LIGHT TRUCK)
- (3) BUMPER-AND-FRAME (BUT NON-EQUALIZING)
- (4) LOAD EQUALIZING

## OTHER TYPES

- (5) RING-AND-PINTLE
- (6) FIFTH-WHEEL (INCL. P/U)
- (7) OTHER (E.G. CLEVIS-AND-PIN)
- (8) EQUIPPED, TYPE UNKNOWN
- (9) UNKNOWN IF EQUIPPED

0  
52

TRAILER TYPE  
(AT TIME OF COLLISION)

- (0) NO TRAILER
- (1) TRAVEL-TRAILER/CAMPER
- (2) MOBILE HOME
- (3) BOAT/SNOWMOBILE/ATV TRAILER
- (4) UTILITY TRAILER
- (5) TOWED CAR
- (7) OTHER: \_\_\_\_\_
- (8) TRAILER, TYPE UNKNOWN
- (9) UNKNOWN

0  
53

## RIGHT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE  
 (9) UNKNOWN

8  
 54

## RIGHT DOORS

HOW DID DOORS  
OPEN DURING COLLISION?

USE CODES:

(00) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (01) HINGE AREA SEPARATION  
 (02) DOOR-LATCH SEPARATION  
 (03) LATCH-STRIKER SEPARATION  
 (04) STRIKER-PILLAR SEPARATION  
 (05) BODY DISTORTION  
 (06) COMBINATION OF ABOVE  
 (CIRCLE EACH)  
 (07) OPENED, REASON UNKNOWN  
 (11) VAN RIGHT-REAR DOOR OPENED  
 (ANY MECHANISM)

(98) NOT APPLICABLE (NO DOOR)

(99) UNKNOWN

-FRONT

0 0  
 63 64

-REAR

0 0  
 65 66

## DOORS JAMMED CLOSED-

USE CODES:

- (0) NO  
 (1) YES  
 (8) NOT APPLICABLE (NO DOOR)  
 (9) UNKNOWN

-FRONT

0  
 67

-REAR

0  
 68

## VAN REAR DOOR TYPE

- (0) VAN, NO REAR DOOR  
 (1) TRACK (SLIDING) - RIGHT SIDE  
 (2) SINGLE-HINGED - RIGHT SIDE  
 (3) DOUBLE-HINGED - RIGHT SIDE  
 (4) TRACK (SLIDING) - RIGHT & LEFT SIDE  
 (5) SINGLE-HINGED - RIGHT & LEFT SIDE  
 (6) DOUBLE-HINGED - RIGHT & LEFT SIDE  
 (7) TRACK AND HINGED COMBINATION  
 (8) NOT APPLICABLE (NOT A VAN)  
 (9) UNKNOWN

8  
 69

## RIGHT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO  
 (1) YES  
 (4) NO SEPARATION, BUT DAMAGED  
 (8) NOT APPLICABLE (NOT EQUIPPED)  
 (9) UNKNOWN

-A-PILLAR, UPPER

0  
 55

LOWER

0  
 56

-B-PILLAR, UPPER

0  
 57

LOWER

0  
 58

-C-PILLAR, UPPER

0  
 59

LOWER

0  
 60

-D-PILLAR, UPPER

0  
 61

LOWER

8  
 62

## EXTERIOR DAMAGE

ED-5

## WINDSHIELD DAMAGE

## WINDSHIELD CRACKED

- (0) NO  
(1) YES  
(8) NOT APPLICABLE  
(9) UNKNOWN

1  
70

WINDSHIELD BROKEN  
(PLASTIC INTERLAYER TORN)

- (0) NO  
(1) YES  
(8) NOT APPLICABLE  
(9) UNKNOWN

0  
71

CRACKED OR BROKEN  
BY OCCUPANT CONTACT

- (0) NO  
(1) YES  
(8) NOT APPLICABLE  
(9) UNKNOWN

0  
72

## EXTENT OF BOND SEPARATION

- (0) NONE  
(1) 1 - 20%  
(2) 21 - 40  
(3) 41 - 60  
(4) 61 - 80  
(5) 81 - 99  
(6) TOTAL  
(7) SEPARATED, AMOUNT  
UNKNOWN  
(8) NOT APPLICABLE  
(9) UNKNOWN

0  
73

## WINDSHIELD MARK ON CASE VEHICLE:

(X) **Carlite** (R)SOLAR TINT  
LAMINATED AS-1(3) [REDACTED] F  
0 [REDACTED]

## WINDSHIELD CODE

- (97) DESCRIBED BUT NOT CODED  
(98) NOT APPLICABLE (NO WINDSHIELD)  
(99) UNKNOWN

97  
74 75


## Roof

DID T-ROOF/SUN ROOF OPEN  
DURING COLLISION?

- (0) NO  
(1) YES  
(8) NOT APPLICABLE  
(NOT A T-ROOF OR SUN ROOF)  
(9) UNKNOWN

8  
76

LOCATE AREA OF WINDSHIELD INTEREST OR DAMAGE WITH DIMENSIONS (VERTICAL & HORIZONTAL) ON THIS DIAGRAM OF THE WINDSHIELD AS VIEWED FROM INSIDE.

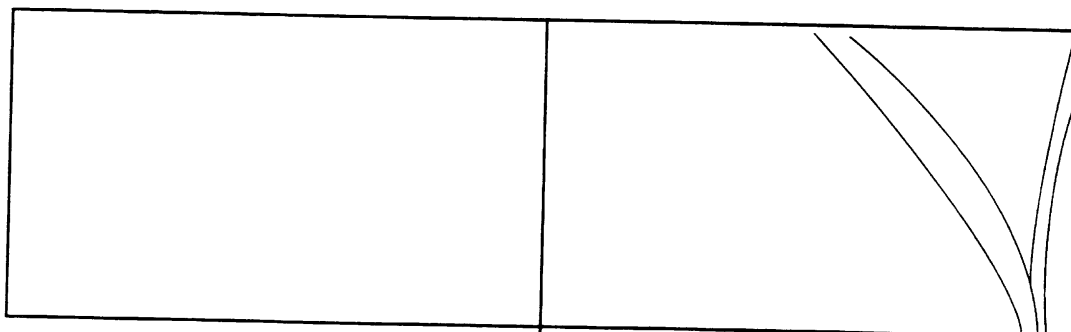

Windshield cracked due to cowl contact

L

C

R



## STEERING WHEEL

### STEERING WHEEL RIM DAMAGE

- (0) NONE
- (1) DEFORMED SLIGHTLY
- (2) SEVERELY BENT
- (3) BROKEN
- (9) UNKNOWN

0  
13

### NUMBER OF STEERING WHEEL SPOKES

- (9) UNKNOWN

4  
14

### STEERING WHL SPOKE DAMAGE

- (0) NONE
- (1) DEFORMED SLIGHTLY
- (2) SEVERELY BENT
- (3) BROKEN
- (9) UNKNOWN

0  
15

### STEERING WHEEL POSITION AT TIME OF COLLISION

IN WHAT O'CLOCK POSITION WAS THE  
NORMAL TOP OF THE WHEEL POINTED  
WHEN THE COLLISION OCCURRED?

#### EXAMPLES

O'CLOCK = 1 2



(NORMAL STRAIGHT  
AHEAD)

O'CLOCK = 0 2



O'CLOCK = 99


(99) UNKNOWN

## STEERING WHEEL ENERGY ABSORBING DEVICE



(1) EXAMPLES:

BARRACUDA, 70 - 74  
CHALLENGER, 70 - 74  
CAPRI, 71 - 77

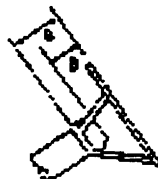

(2) EXAMPLES:

OMNI, 78 -  
HORIZON, 78 -

## STEERING COLUMN OPTIONS

### TILT FEATURE

- (0) NOT EQUIPPED
- (1) YES, EQUIPPED, UNK POSITION
- (2) UP
- (3) MIDDLE
- (4) LOWER
- (9) UNKNOWN IF EQUIPPED

3  
16

### SWING-AWAY FEATURE

- (0) NOT EQUIPPED
- (1) YES, EQUIPPED
- (9) UNKNOWN IF EQUIPPED

0  
17

### TELESCOPING FEATURE

- (0) NOT EQUIPPED
- (1) YES, EQUIPPED
- (9) UNKNOWN IF EQUIPPED

0  
18

### TYPE OF DEVICE

- (0) NONE
- (1) CONVOLUTED OR MESH CYLINDER
- (2) DEEP DISH STEERING WHEEL
- (7) OTHER: \_\_\_\_\_
- (8) NOT COLLECTED
- (9) UNKNOWN IF EQUIPPED

8  
19

### ORIGINAL DIMENSION (mm)

A: \_\_\_\_\_

### DAMAGE DIMENSION (mm)

B: \_\_\_\_\_

### DIFFERENCE (mm)

A - B

- (888) NOT COLLECTED
- (991) NOT MEASURED/NO APPARENT  
COMPRESSION
- (992) COMPRESSED, AMOUNT UNKNOWN
- (993) DEVICE EXTENDED
- (997) UNABLE TO MEASURE
- (998) NOT APPLICABLE (NOT EQUIPPED)
- (999) UNKNOWN

8 8 8  
20 22

## STEERING WHEEL AND COLUMN SC-2

STEERING COLUMN  
ENERGY ABSORBING DEVICE

TYPE OF DEVICE \* (IF 27 OR 28)

- (00) NOT EQUIPPED  
(88) NOT COLLECTED  
(99) UNKNOWN

$$\frac{8}{23} \quad \frac{8}{24}$$

ORIGINAL LENGTH (mm)

C: \_\_\_\_\_

COMPRESSED LENGTH (mm)

D: \_\_\_\_\_

BRACKET DEFLECTION (IF CODE 36, 48,  
OR 49 ABOVE)

OR

COMPRESSION (OR EXTRUSION) (mm)

C - D (OR E) (TOLERANCE:  $\pm 10$ )

- (888) NOT COLLECTED  
(991) NOT MEASURED/NO APPARENT  
COMPRESSION  
(992) COMPRESSED, AMOUNT UNKNOWN  
(993) DEVICE EXTENDED  
(997) UNABLE TO BE MEASURED  
(998) NOT APPLICABLE (NOT EQUIPPED)  
(999) UNKNOWN


$$\frac{8}{25} \quad \frac{8}{26} \quad \frac{8}{27}$$

\* (ADD A &amp; B FOR TOTAL COMPRESSION)

SHEAR CAPSULE SEPARATION (mm)

S (USE AVG. OF LEFT &amp; RIGHT CAPSULES.)

LT:

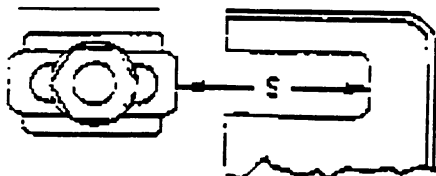

RT:

- (888) NOT COLLECTED  
(991) NOT MEASURED/NO APPARENT  
SEPARATION  
(992) SEPARATED, AMOUNT UNKNOWN  
(997) UNABLE TO BE MEASURED  
(998) NOT APPLICABLE (NOT EQUIPPED)  
(999) UNKNOWN

$$\frac{8}{28} \quad \frac{8}{29} \quad \frac{8}{30}$$

## COLUMN VERTICAL ROTATION

- (0) NO APPARENT ROTATION  
(1) UPWARD APPARENT ROTATION  
(2) DOWNWARD APPARENT ROTATION  
(9) UNKNOWN

$$\frac{0}{31}$$

## COLUMN LATERAL ROTATION

- (0) NO APPARENT ROTATION  
(1) LEFT APPARENT ROTATION  
(2) RIGHT APPARENT ROTATION  
(9) UNKNOWN

$$\frac{0}{32}$$

## STEERING WHEEL (CONTINUED)

## STEERING WHEEL HUB DAMAGE

- (0) NONE  
(1) OCCUPANT CONTACT  
(2) AIRBAG  
(3) OTHER \_\_\_\_\_  
(9) UNKNOWN

$$\frac{0}{33}$$



-1 = Definitely 2 = Probably 3 = Possible


## INTRUSION IT-1

Location of Intrusion	Intruded Component	(All Measurements Are in Centimeters)			Dominant Crush Direction
		Comparison Value	– Intruded Value	= Intrusion	
12	Transmission tunnel		–	= 3	Z
13	Transmission tunnel		–	= 11	Y
13	Floor		–	= 7	Z
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	
			–	=	

## OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	Rt. sunvisor	Driver	Head	Scuffmark and broken plastic	1
B	Vertical console	Driver	Lower extremity	Scuffmark	1
C	Mid instrument panel	Driver	Lower extremity	Scuffmark	1
D	Center armrest/console	Driver	Right side	Scuffmark	1
E	Vertical console	Driver	Lower extremity	Scuffmark	1
F	Lt. sunvisor	Driver	Head	Scuffmark	1
G	Upper Instrument panel	Driver	Upper extremity	Scuffmark	1

VEHICLE OCCUPANT CONTACT DIAGRAM

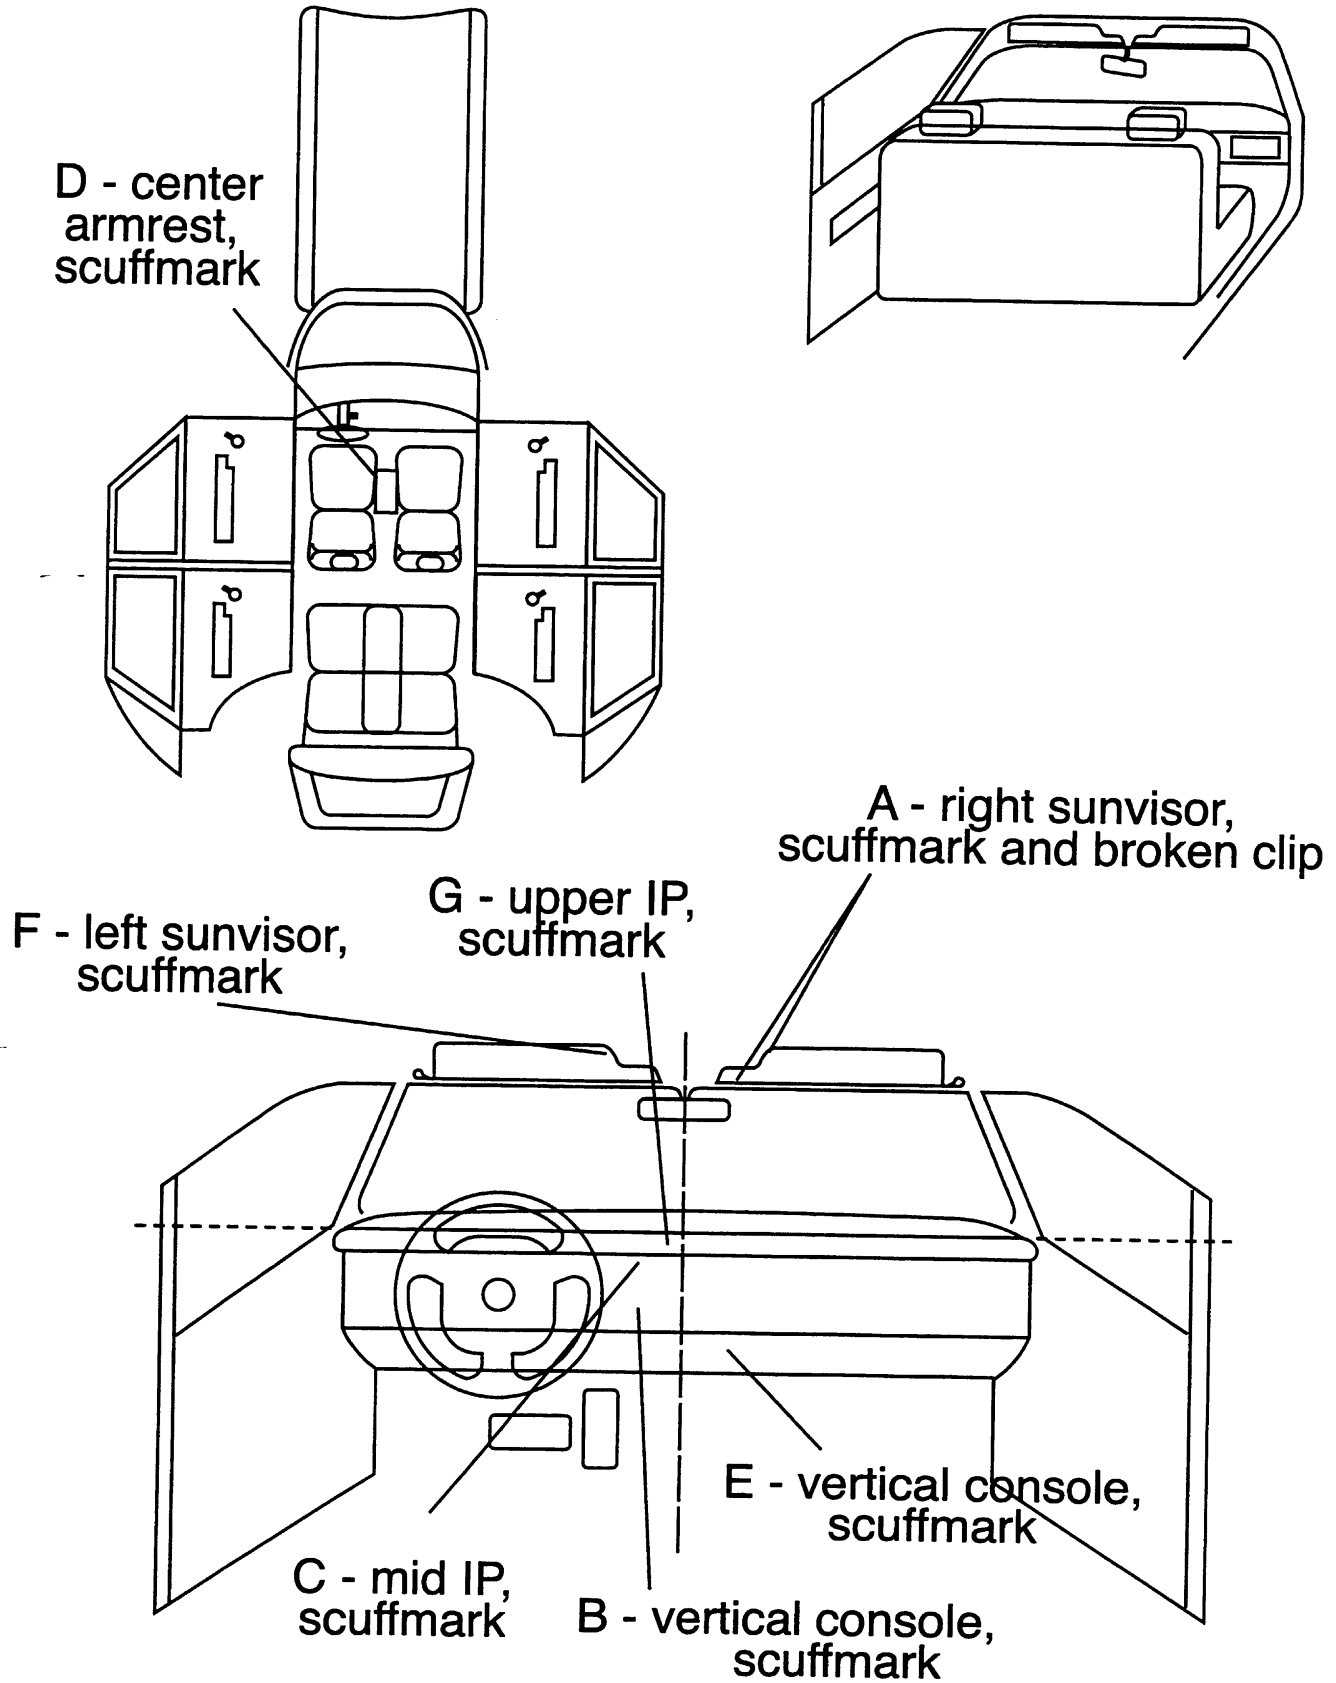

## CODES FOR COLUMN B, OCCUPANT SPACE NUMBER

OCCUPANT SPACE NUMBER IS A TWO-DIGIT CODE. THE USE OF THE CODE IS DETERMINED BY THE VEHICLE SEAT CONFIGURATION AT THE TIME OF THE ACCIDENT.

## FIRST DIGIT

THE FIRST DIGIT (LEFT DIGIT) DENOTES THE SEAT ROW, WITH CODE VALUES FROM 1 TO 5.

## SECOND DIGIT

THE SECOND DIGIT (RIGHT DIGIT) DENOTES THE POSITION ON THE SEAT AND, IN SOME INSTANCES, THE WIDTH OF THE SEAT.

- |                          |                 |                          |   |
|--------------------------|-----------------|--------------------------|---|
| (1) LEFT                 | (3) RIGHT       | .....                    | INDIVIDUAL SEAT                               |
| (1) LEFT                 | (2) CENTER      | (3) RIGHT                | ..... BENCH: FULL WIDTH 3 PASSENGER           |
| (1) LEFT                 | (2) LEFT CENTER | (6) RIGHT CENTER         | (3) RIGHT ..... BENCH: FULL WIDTH 4 PASSENGER |
| (1) LEFT                 | (2) CENTER      | (5) RIGHT & AISCLE SPACE | ..... BENCH: PARTIAL WIDTH, LEFT              |
| (0) LEFT & SPACE         | (2) CENTER      | (5) RIGHT & SPACE        | ..... BENCH: PARTIAL WIDTH, CENTERED          |
| (4) ENTIRE VEHICLE WIDTH | .....           | CARGO AREA               |   |

## EXAMPLES

THE TWO FIGURES BELOW PROVIDE EXAMPLES OF THE OCCUPANT SPACE NUMBER.

PASSENGER CAR  
5 PASSENGERS

X	X	11	13
X	X	21	22 23

VAN  
12 PASSENGER CAPACITY

X	X	11	13
X	X	X	21 22 25
X	X	X	31 32 35
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X	X
X	X	X</	

## CODES FOR COLUMN F, MEASUREMENT AXIS

- (X) X-AXIS (FORE & AFT)  
(Y) Y-AXIS (LATERAL)  
(Z) Z-AXIS (VERTICAL)

## CODES FOR COLUMNS G, H, I &amp; J, OCCUPANT &amp; INJURY NUMBERS

OCCUPANT NUMBER	INJURY NUMBER	<u>CONTACT</u>
(00)	(00)	NO CONTACT
(##)	(00)	CONTACT, NO INJURY
(97)	(99)	CONTACT, OCCUPANT UNKNOWN, INJURY UNKNOWN
(99)	(00) OR (99)	UNKNOWN IF CONTACT



## CODES FOR COLUMN C, INTRUDING COMPONENT OR OBJECT

NOTE: DO NOT CODE OBJECTS OTHER THAN COMPONENTS OF CASE VEHICLE.

## INDIVIDUAL COMPONENT

## INTERNAL

- (01) INSTRUMENT PANEL
- (02) FIRE WALL
- (03) TOE PAN
- (04) FLOOR PAN
- (05) STEERING COLUMN
- (06) WINDSHIELD
- (07) WINDSHIELD HEADER
- (08) A-PILLAR
- (09) DOOR PANEL OR SIDE PANEL
- (10) WINDOW FRAME
- (11) B-PILLAR
- (12) C-PILLAR
- (13) D-PILLAR
- (14) ROOF SIDE RAILS
- (15) ROOF OR CONVERTIBLE TOP
- (16) BACKLIGHT HEADER
- (17) FRONT SEAT-BACK SURFACE/  
SEAT-BACK BACK SURFACE
- (18) SECOND SEAT-BACK SURFACE  
SEAT-BACK BACK SURFACE
- (19) THIRD SEAT-BACK SURFACE  
SEAT-BACK BACK SURFACE
- (20) FOURTH SEAT-BACK SURFACE  
SEAT-BACK BACK SURFACE
- (21) FIFTH SEAT-BACK SURFACE  
SEAT-BACK BACK SURFACE
- (22) BACK PANEL/BACK DOOR SURFACE
- (23) SEAT CUSHION SURFACE/EDGE
- (24) CONSOLE
- (25) OTHER (*DESCRIBE*)
- (26) UNKNOWN INTERNAL SURFACES
- (28) TRANSMISSION TUNNEL (HUMP)
- (29) SIDE FOOTWELL PANEL (KICKPANEL)
- (30) SILL

## EXTERNAL

- (43) HOOD
- (44) OBJECT EXTERNAL TO PASSENGER  
COMPARTMENT BUT PART  
OF CASE VEHICLE
- (45) OUTSIDE SURFACE OF CASE VEHICLE
- (46) OTHER (*E.G. SPARE TIRE,  
JACK. DESCRIBE.*)
- (49) UNKNOWN EXTERNAL OBJECT

## GROUPED FOR MASSIVE INTRUSION INTO AN OCCUPANT SPACE

USE ONLY IF ALL THESE COMPONENTS  
INTRUDED INTO A SINGLE OCCUPANT SPACE.

- |                        |                         |
|------------------------|-------------------------|
| (50) WINDSHIELD HEADER | (60) ROOF               |
| A-PILLAR               | ROOF RAIL               |
| ROOF SIDE RAIL         | A-PILLAR                |
|                        | B-PILLAR                |
|                        | C-PILLAR                |
| (51) INSTRUMENT PANEL  | WINDOW FRAME            |
| A-PILLAR               | DOOR PANEL              |
| DOOR PANEL             | FLOOR PAN               |
| (52) INSTRUMENT PANEL  | (61) INSTRUMENT PANEL   |
| A-PILLAR               | TOE PAN                 |
| WINDSHIELD HEADER      | WINDSHIELD HEADER       |
|                        | A-PILLAR                |
| (53) DOOR PANEL        | ROOF RAIL               |
| B-PILLAR               | WINDOW FRAME            |
| ROOF RAIL              | DOOR PANEL              |
| (54) DOOR PANEL        | ROOF                    |
| A-PILLAR               | (62) ROOF               |
| ROOF RAIL              | ROOF RAIL               |
| (55) INSTRUMENT PANEL  | C-PILLAR                |
| FLOOR PAN              | WINDOW FRAME            |
| A-PILLAR               | FLOOR PAN               |
| DOOR FRAME             | SECOND SEAT             |
| (56) ROOF RAIL         | DOOR PANEL              |
| A-PILLAR               | (63) ROOF RAIL          |
| B-PILLAR               | ROOF                    |
| WINDOW FRAME           | B-PILLAR                |
| (57) ROOF RAIL         | WINDOW FRAME            |
| A-PILLAR               | FLOOR PAN               |
| B-PILLAR               | DOOR PANEL              |
| C-PILLAR               | SECOND SEAT             |
| DOOR PANEL             | FRONT SEAT              |
| (58) ROOF              | (64) ROOF RAIL          |
| ROOF RAIL              | ROOF OR CONVERTIBLE TOP |
| WINDOW FRAME           | A-PILLAR                |
| DOOR PANEL             | B-PILLAR                |
| (59) BACKLIGHT HEADER  | WINDOW FRAME            |
| ROOF                   | WINDOW HEADER           |
| C-PILLAR               | (65) WINDSHIELD         |
| THIRD SEAT-BACK        | WINDSHIELD HEADER       |
|                        | ROOF SIDE RAIL          |
|                        | (66) WINDSHIELD         |
|                        | WINDSHIELD HEADER       |
|                        | A-PILLAR                |
|                        | (98) NOT APPLICABLE     |
|                        | (99) UNKNOWN            |



Duplicate columns 1-8  
from the previous card.

Module 1 T Format 0 1  
9 10 11 12

INTRUSION IT-5

WAS THERE OCCUPANT COMPARTMENT INTRUSION? 1  
13

- (0) NO DO NOT ANSWER NEXT QUESTION. SKIP PAGE.  
(1) YES ANSWER NEXT QUESTION.  
(9) UNKNOWN SKIP PAGE.

WAS INTRUSION CATASTROPHIC? 0  
14

- (0) NO COMPLETE PAGE.  
(1) YES SKIP PAGE.

Duplicate columns 1-8  
from the previous card.

Module 1 T Format 0 2  
9 10 11 12

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

**INTRUSIONS** CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.

CODES FOR B, F, G, H, I, J ON PAGE IT-3

CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14-	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0 1</u>	<u>1 2</u>	<u>2 8</u>	<u>1</u>	<u>0 0</u>	<u>0 0</u>	<u>0 3</u>	<u>0 0</u>	<u>0 0</u>	<u>0 0</u>	<u>0 0</u>
<u>0 2</u>	<u>1 3</u>	<u>2 8</u>	<u>1</u>	<u>0 0</u>	<u>1 1</u>	<u>0 0</u>	<u>0 0</u>	<u>0 0</u>	<u>0 0</u>	<u>0 0</u>
<u>0 3</u>	<u>1 3</u>	<u>0 4</u>	<u>1</u>	<u>0 0</u>	<u>0 0</u>	<u>0 7</u>	<u>0 0</u>	<u>0 0</u>	<u>0 0</u>	<u>0 0</u>
<u>0 4</u>	—	—	—	—	—	—	—	—	—	—
<u>0 5</u>	—	—	—	—	—	—	—	—	—	—
<u>0 6</u>	—	—	—	—	—	—	—	—	—	—
<u>0 7</u>	—	—	—	—	—	—	—	—	—	—

NOTE: USE ADDITIONAL PAGE IF MORE THAN 7 INTRUSIONS.

Duplicate columns 1-8  
from the previous card.

Module 1 T Format 0 3  
9 10 11 12

NOTE: IF NO SIDE DOOR INTRUSION,  
SKIP REMAINDER OF PAGE.

**SIDE DOOR INTRUSION  
RESULTED FROM**

INTRUSION  
NUMBER CAUSE

CODES  
FOR CAUSE:

13 — (1) DIRECT  
16 — (2) IMPACT  
18 — (2) INDUCED  
19 — (9) DAMAGE  
21 — (9) UNKNOWN

**IF DAMAGE TO DOOR COMPONENT RESULTED IN INCREASED  
DOOR INTRUSION, CODE COMPONENT**

INTRUSION  
NUMBER

DAMAGED  
COMPONENT 1

DAMAGED  
COMPONENT 2

CODES  
FOR COMPONENTS

A —  
22 23

B —  
26 27

C —  
30 31

D —  
34 35

25

29

33

37

- (0) NONE  
(1) A-PILLAR  
(2) B-PILLAR  
(3) C-PILLAR  
(4) LATCH/STRIKER  
(5) HINGES  
(7) OTHER: \_\_\_\_\_  
(8) NOT APPLICABLE  
(9) UNKNOWN

Duplicate columns 1-8  
from the previous card.

Module I T Format 0 2  
9 10 11 12

INTRUSION IT-6

NOTE: Each line in the table below is a separate record (card).  
Duplicate columns 1 - 12 for each completed line.

-- ADDITIONAL PAGE --

**INTRUSIONS** CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.  
CODES FOR B, F, G, H, I, J ON PAGE IT-3  
CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0</u> <u>8</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0</u> <u>9</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1</u> <u>0</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1</u> <u>1</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1</u> <u>2</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1</u> <u>3</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1</u> <u>4</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1</u> <u>5</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1</u> <u>6</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1</u> <u>7</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1</u> <u>8</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1</u> <u>9</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2</u> <u>0</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2</u> <u>1</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2</u> <u>2</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2</u> <u>3</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2</u> <u>4</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2</u> <u>5</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —

Duplicate columns 1-8  
from the previous card.

Module 1 D Format 0 1  
9 10 11 12

# INTERIOR DAMAGE

ID-1

## CODES:

- |                              |                               |
|------------------------------|-------------------------------|
| (0) NO                       | (4) YES, and OCCUPANT CONTACT |
| (1) YES                      | (8) NOT APPLICABLE            |
| (3) NO, and OCCUPANT CONTACT | (9) UNKNOWN                   |

	LEFT	RIGHT				
<b>SIDES</b>			<b>FRONT</b>		<b>INSTRUMENT PANEL</b>	
FRONT DOOR	<u>0</u> 13	<u>0</u> 14	FOOT CONTROLS <i>B.P</i>	<u>1</u> 45	UPPER PANEL	<u>4</u> 55
FRONT HARDWARE	<u>0</u> 15	<u>0</u> 16	IGNITION KEYS	<u>0</u> 46	MID PANEL	<u>3</u> 56
FRONT ARMREST	<u>0</u> 17	<u>0</u> 18	REAR VIEW MIRROR	<u>0</u> 47	LOWER PANEL	<u>1</u> 57
FRONT GLASS	<u>0</u> 19	<u>0</u> 20	SUNVISOR/FITTINGS	<u>7</u> 48	ASHTRAY	<u>0</u> 58
REAR DOOR AREA	<u>0</u> 21	<u>0</u> 22	(5) LEFT SIDE ONLY <i>-3</i> (6) RIGHT SIDE ONLY <i>-4</i> (7) BOTH SIDES		CONTROL KNOBS & LEVERS	<u>0</u> 59
REAR HARDWARE	<u>0</u> 23	<u>0</u> 24	WINDSHIELD TOP MOLDINGS	<u>0</u> 49	GLOVE COMPARTMENT AREA <i>- JAMMED</i> <i>Closed</i> <i>Prried</i> <i>Open</i>	<u>0</u> 60
REAR ARMREST	<u>0</u> 25	<u>0</u> 26	LEFT A-PILLAR (UPPER OR LOWER)	<u>0</u> 50	INSTRUMENTS	<u>0</u> 61
REAR GLASS	<u>0</u> 27	<u>0</u> 28	RIGHT A-PILLAR (UPPER OR LOWER)	<u>0</u> 51	PARKING BRAKE RELEASE	<u>0</u> 62
ROOF SIDE RAIL	<u>0</u> 29	<u>0</u> 30	CENTER CONSOLE	<u>4</u> 52	PARKING BRAKE PEDAL	<u>0</u> 63
B-PILLAR	<u>0</u> 31	<u>0</u> 32	TRANSMISSION SELECTOR LEVER	<u>0</u> 53	A/C OR UPPER VENT OUTLETS	<u>0</u> 64
C-PILLAR	<u>0</u> 33	<u>0</u> 34	RIM, HORN, SPOKE	<u>0</u> 54	HEATER OR A/C DUCTS	<u>0</u> 65
D-PILLAR	<u>0</u> 35	<u>0</u> 36			RADIO	<u>0</u> 66
HEADLINING	<u>0</u> 37	<u>0</u> 38			OTHER: * _____	<u>8</u> 67
ROOF STRUCTURE	<u>0</u> 39	<u>0</u> 40				
T-ROOF/SUN ROOF	<u>8</u> 41	<u>8</u> 42				
OTHER: * _____	<u>8</u> 43	<u>8</u> 44				
					<b>REAR</b>	
					WINDOW	<u>0</u> 68
					WINDOW HEADER	<u>0</u> 69
					<b>CONSOLES</b>	
					VERTICAL	<u>4</u> 70
					ROOF	<u>8</u> 71

\* MORE THAN ONE ITEM MAY BE NOTED.

Duplicate columns 1-8  
from the previous card.

Module S T Format 0 2  
9 10 11 12

## SEATS

ST-1

FRONT SEAT		DRIVER	PASSENR	FRONT SEAT-BACK		DRIVER	PASSENR		
<b>TYPE OF FRONT SEAT</b> (00) NO SEAT (01) STANDARD BENCH (02) SPLIT BACK, 50-50 (03) SPLIT BACK, DRIVER WIDE (04) SPLIT BACK, PASS. WIDE (05) BUCKET (06) CAPTAIN'S CHAIR (07) INDIV. BENCH, 50-50 (08) INDIV. BENCH, DRIVER WIDE (09) INDIV. BENCH, PASS. WIDE (97) OTHER: _____ (99) UNKNOWN		<u>0</u> 13	<u>5</u> 14	<u>0</u> 15	<u>5</u> 16	<b>SEAT-BACK TYPE</b> (1) FORWARD FOLDING (2) RIGID (3) RECLINING (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>3</u> 30	<u>3</u> 31
<b>TYPE OF SEAT MOUNT</b> (1) STANDARD (2) PEDESTAL (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 17	<u>1</u> 18	<b>SEAT-BACK LOCK TYPE</b> (0) NONE (1) MANUAL (2) INERTIA (3) POWER (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 32	<u>1</u> 33		
<b>SWIVEL MECHANISM EQUIPPED</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 19	<u>0</u> 20	<b>LOCKS HELD</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 34	<u>1</u> 35		
<b>ORIGINAL EQUIPMENT SEATS</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 21	<u>1</u> 22	<b>RECLINER MECHANISM HELD</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 36	<u>1</u> 37		
<b>CONTACT OF SEAT BY REAR OCCUPANT</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>8</u> 23	<u>8</u> 24	<b>HEAD RESTRAINT</b> <b>HEAD RESTRAINT TYPE</b> (0) NONE (1) ADJUSTABLE (2) INTEGRAL (3) NOT INTEGRAL, BUT CANNOT BE REMOVED (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 38	<u>1</u> 39		
<b>FRONT SEAT DAMAGE</b> (0) NONE (1) BACKREST ONLY DAMAGED (2) CUSHION ONLY DAMAGED (3) BACKREST & CUSHION DAMAGED (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 25	<u>0</u> 26	<b>REMOVED PRE-CRASH</b> (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 40	<u>0</u> 41		
<b>CENTER ARMREST DAMAGED</b> (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED		<u>1</u> 27		<b>ADJUSTMENT AT CRASH</b> (1) UP (2) DOWN (8) NOT APPLICABLE (9) UNKNOWN		<u>2</u> 42	<u>2</u> 43		
<b>FRONT SEAT ROTATION</b> (0) NONE APPARENT (1) FORWARD APPARENT (2) REARWARD APPARENT (3) LEFT APPARENT (4) RIGHT APPARENT (5) MULTIPLE ROTATIONS SPECIFY _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 28	<u>0</u> 29	<b>HEAD RESTRAINT DAMAGE</b> (0) NONE (1) DAMAGED BUT NOT SEPARATED (2) SEPARATED (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 44	<u>0</u> 45		

FRONT SEAT ADJUSTMENT		DRIVER	PASSENGER	SECOND SEAT (CONT.)	
SEAT ADJUSTMENT TYPE				CENTER ARMREST DAMAGED	
(0) NONE (RIGID) (1) MANUAL (2) POWER (7) OTHER: _____ (8) NOT APPLICABLE (NO SEAT) (9) UNKNOWN		<u>2</u> 46	<u>1</u> 47	(0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED	
ADJUSTMENT PROVIDED				SECOND SEAT-BACK	
(1) 2-WAY (2) 4-WAY (3) 6-WAY (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>3</u> 48	<u>1</u> 49	LEFT RIGHT LOCKS	
SEAT ADJUSTER DAMAGE				FOR THE FOLLOWING, USE:	
(0) NONE (1) CHUCKING (FREE PLAY) (2) DEFORMED (RELEASED/JAMMED) (3) SEPARATED (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 50	<u>0</u> 51	(0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN	
SEAT ADJUSTER SEPARATION				LEFT OR CENTER, EQUIPPED	
(0) NONE (1) SEPARATED AT FLOOR (2) SEPARATION OF ADJUSTER (3) SEPARATED AT SEAT (8) NOT APPLICABLE (9) UNKNOWN		<u>8</u> 52	<u>8</u> 53	<u>1</u> 61	<u>0</u> 62
PRE-CRASH POSITION				LEFT OR CENTER, HELD	
(1) FORWARD (2) MIDDLE (3) REARWARD (8) NOT APPLICABLE (9) UNKNOWN		<u>2</u> 54	<u>3</u> 55	<u>1</u> 63	<u>8</u> 64
				(3) SEAT FOLDED DOWN	
				RIGHT, EQUIPPED	
				<u>0</u> 65	<u>1</u> 66
				RIGHT, HELD	
				<u>8</u> 67	<u>1</u> 68
				(3) SEAT FOLDED DOWN	
				THIRD SEAT	
SECOND SEAT		LEFT	RIGHT	EQUIPPED	
TYPE OF SECOND SEAT				<u>0</u> 69	<u>0</u> 70
(0) NONE (1) NON-FOLDING (2) FOLDING (3) CAPTAIN'S CHAIR (4) JUMP SEAT (5) INTEGRAL CHILD SEAT (6) LUGGAGE AREA ACCESS PANEL (9) UNKNOWN		<u>6</u> 56	<u>6</u> 57	BACKREST DAMAGED	
				<u>8</u> 71	<u>8</u> 72
				CUSHION DAMAGED	
				<u>8</u> 73	<u>8</u> 74
SECOND SEAT DAMAGE				VEHICLE EQUIPPED WITH REAR HEAD RESTRAINTS	
(0) NONE (1) BACKREST ONLY (DAMAGED OR LOOSENED) (2) CUSHION ONLY (DAMAGED OR LOOSENED) (3) BACKREST & CUSHION (DAMAGED OR LOOSENED) (4) INTEGRAL CHILD SEAT (PRIORITY CODE) (5) LUGGAGE AREA ACCESS PANEL (DAMAGED OR LOOSENED) (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 58	<u>0</u> 59	(0) NOT EQUIPPED (OR REMOVED) (1) EQUIPPED (2) EQUIPPED & DAMAGED (8) NOT APPLICABLE (NO REAR SEAT) (9) UNKNOWN	
				Applies to any rear-seat position <u>0</u> 75	


Duplicate columns 1-8  
from the previous card.

Module A B Format 0 1  
9 10 11 12

AIRBAG AB-1

<p>DRIVER SIDE</p> <p>LOCATION OF AIRBAG</p> <p>STEERING WHEEL</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 13</p> <p><u>1</u> 14</p>	<p>PASSENGER SIDE</p> <p>LOCATION OF AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 16</p> <p><u>1</u> 17</p>
<p>CONDITION OF AIRBAG</p> <p>STEERING WHEEL</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>0</u> 15</p>	<p>CONDITION OF AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>0</u> 18</p>
<p>DRIVER SIDE</p> <p>AIRBAG</p> <p>STEERING WHEEL</p> <p>TETHER</p> <p>(0) NO (1) YES <u>2</u> (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 19</p> <p><u>0</u> 20</p>	<p>PASSENGER SIDE</p> <p>AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>TETHER</p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 21</p> <p><u>0</u> 22</p>

AIRBAG NUMBER ON DRIVER SIDE:

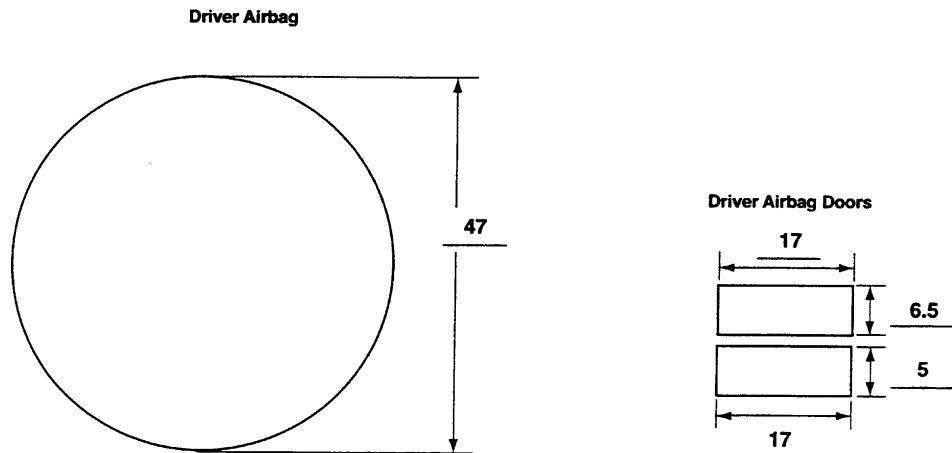


Vents: ☒ Y ☐ N  
if yes, how many: 2

Tethers: ☒ Y ☐ N  
if yes, how many: 2

at 11 and 1 o'clock

AIRBAG NUMBER ON PASSENGER SIDE:

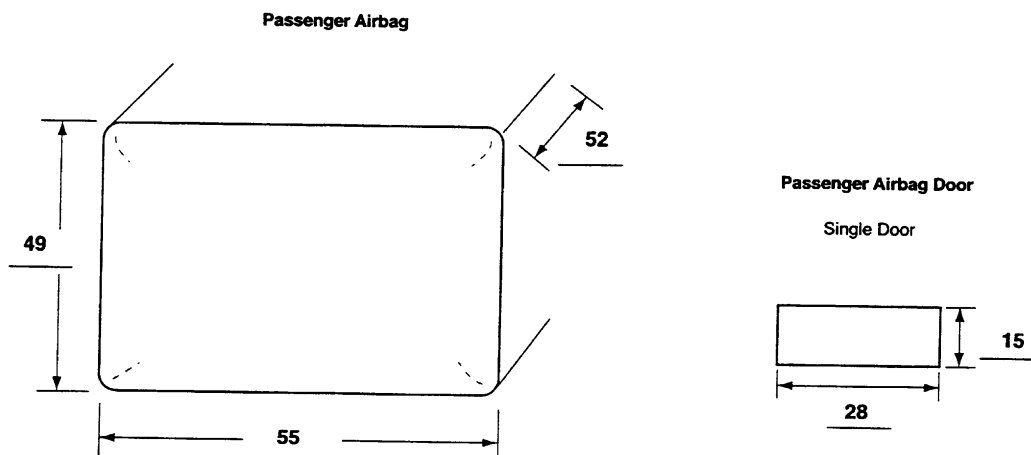

Vents: Y ☒ N  
if yes, how many: \_\_\_\_\_

Tethers: ☒ Y ☐ N  
if yes, how many: 2

NOTE TO THE INVESTIGATOR:

THE FOLLOWING TWO SECTIONS,  
OCCUPANT INFORMATION AND INJURY CLASSIFICATION,  
ARE TO BE FILLED IN  
FOR EACH CASE VEHICLE OCCUPANT,  
WHETHER INJURED OR NOT.

IF THERE IS MORE THAN ONE OCCUPANT,  
USE ADDITIONAL COPIES  
OF PAGES OC-1, OC-2, OC-3,  
AND IC-2 TO DESCRIBE THEM  
AND ATTACH THE COPIES TO THIS REPORT.



Duplicate columns 1-8  
from the previous card.

Module 0 C Format 0 2  
9 10 11 12

## OCCUPANT INFORMATION OC-1

### OCCUPANT IDENTIFICATION

OCCUPANT NUMBER

0 1  
13 14

ROLE OF OCCUPANT AT 1ST IMPACT

- (1) MOTOR VEHICLE DRIVER  
(2) MOTOR VEHICLE PASSENGER  
(NOT DRIVER)  
(9) UNKNOWN

1  
15

### OCCUPANT POSITION

ROW LOCATION

- (1) FRONT  
(2) SECOND  
(3) THIRD  
(4) FOURTH  
(7) OTHER: \_\_\_\_\_  
(8) EXTERNAL TO PASSENGER  
COMPARTMENT (E.G. BED OF PICKUP)  
(9) UNKNOWN

1  
16

LATERAL LOCATION

- (1) LEFT  
(2) LEFT CENTER  
(3) CENTER  
(4) RIGHT CENTER  
(5) RIGHT  
(6) ALL (LYING ON SEAT)  
(8) EXTERNAL TO PASSENGER  
COMPARTMENT  
(9) UNKNOWN

1  
17

POSTURE

- (10) SITTING ON SEAT  
(11) SITTING ON SEAT IN ABNORMAL  
POSITION (E.G. FEET ON DASH,  
SIDEWAYS)  
(12) SITTING ON CONSOLE  
(20) ON LAP OR IN ARMS  
(30) STANDING ON SEAT  
(40) STANDING ON FLOOR  
(47) STANDING, EXTERNAL TO  
PASSENGER COMPARTMENT  
(50) IN BASSINET  
(60) IN CHILD SEAT  
(65) IN CHILD HARNESS  
(70) LYING ON SEAT  
(80) LYING/SITTING ON PASSENGER  
FLOOR  
(83) LYING/SITTING ON OTHER  
OBJECT IN PASSENGER  
COMPARTMENT: \_\_\_\_\_  
(85) ON CARGO FLOOR/FOLDED  
SEAT-BACK  
(87) LYING/SITTING, EXTERNAL TO  
PASSENGER COMPARTMENT  
(97) OTHER: \_\_\_\_\_  
(99) UNKNOWN

1 0  
18 19

### PHYSICAL DESCRIPTION

AGE IN YEARS

- (00) LESS THAN 1 YEAR  
(98) 98 YEARS OR OLDER  
(99) UNKNOWN

1 8  
20 21

AGE IN MONTHS

- (00) LESS THAN 1 MONTH  
(25) 25 MONTHS OR OLDER  
(99) UNKNOWN

2 5  
22 23

MASS (kg)

- (999) UNKNOWN

(175 lb)

0 7 9  
24 25 26

HEIGHT (cm)

- (999) UNKNOWN

(5 ft, 10.5 in)

1 7 9  
27 28 29

SEX

- (1) MALE  
(2) FEMALE  
(9) UNKNOWN

1  
30

### MEDICAL CONDITIONS

TREATMENT/MORTALITY

- (00) NONE  
(01) FIRST AID AT SCENE  
(02) TREATED AT HOSPITAL/CLINIC  
BUT NOT ADMITTED  
(03) HOSPITALIZED FOR OBSERVATION  
LESS THAN 24 HOURS  
(04) HOSPITALIZED OVER 24 HOURS  
OR FOR SIGNIFICANT TREATMENT  
(05) FATAL, DEAD AT SCENE  
(06) FATAL, DOA  
(07) FATAL, DEAD WITHIN 24 HOURS  
(08) FATAL, DEAD 24 HOURS TO  
31 DAYS LATER  
(09) FATAL, DEAD 31 DAYS TO  
1 YEAR LATER  
(10) FATAL DEAD WITHIN UNKNOWN  
PERIOD  
(99) UNKNOWN

0 2  
31 32

INJURY SEVERITY SCORE (ISS)

- (99) UNKNOWN

0 1  
33 34

NON-IMPACT MED. CONDITIONS

- (0) NONE  
(1) YES, TIME & TYPE UNKNOWN  
(2) PRE-CRASH FATAL (CLINICAL  
DEATH AT WHEEL)  
(3) PRE-CRASH NON-FATAL (E.G.  
PRIOR INJURY, STROKE)  
(4) PREGNANT  
(5) POST-CRASH FATAL (DROWNING)  
(6) POST-CRASH NON-FATAL INJURY  
(7) OTHER: \_\_\_\_\_  
(8) COMBINATION OF ABOVE  
(CIRCLE EACH)  
(9) UNKNOWN

0  
35



OCCUPANT INFORMATION OC-2			
<b>MEDICAL CONDITIONS (CONT.)</b>  <b>POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT</b>  (0) O - NO INJURY (1) C - POSSIBLE INJURY (2) B - NON-INCAPACITATING (3) A - INCAPACITATING INJURY (4) K - FATAL (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO IMPACT (7) NON-FATAL INJURY, SEVERITY UNKNOWN (9) UNKNOWN	<div>3</div> <div>36</div>	<b>CHILD SEAT TYPE</b>  (00) NONE USED (01) YES, USED (02) INTEGRAL, Chrysler Mini-van (88) NOT APPLICABLE (ADULT OR OLDER CHILD) (99) UNKNOWN  <b>CHILD SEAT MAKE/MODEL</b>  _____  _____  _____	<div>88</div> <div>41 42</div>
<b>RESTRAINT SYSTEM</b>  <b>ACTIVE RESTRAINT SYSTEM</b>  (0) NONE (1) LAP BELT (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (9) UNKNOWN  <b>ACTIVE RESTRAINT SYSTEM USAGE</b>  (0) NONE (AVAILABLE BUT NOT USED) (1) LAP BELT ONLY (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (7) IMPROPER USAGE (8) NOT APPLICABLE (NONE AVAILABLE) (9) UNKNOWN  <b>PASSIVE RESTRAINT SYSTEM</b>  (0) NONE (1) AIRBAG INSTALLED (2) PASSIVE UPPER TORSO WITH KNEE BOLSTERS (3) PASSIVE UPPER TORSO WITHOUT KNEE BOLSTERS (4) PASSIVE LAP & UPPER TORSO (5) AIRBAG INSTALLED & PASSIVE RESTRAINT (7) OTHER: _____ (9) UNKNOWN  <b>PASSIVE RESTRAINT SYSTEM USAGE</b>  (0) SYSTEM DEFEATED (1) AIRBAG NOT DEPLOYED (2) AIRBAG DEPLOYED (3) AIRBAG NOT REINSTALLED (4) PASSIVE UPPER TORSO USED (5) PASSIVE LAP & UPPER TORSO USED (6) SYSTEM USED IN MANUAL MODE (7) IMPROPER USAGE (8) NOT APPLICABLE (NOT ORIGINALLY EQUIPPED) (9) UNKNOWN	<div>3</div> <div>37</div>  <div>0</div> <div>38</div>  <div>1</div> <div>39</div>  <div>2</div> <div>40</div>	<b>EJECTION</b>  <b>DEGREE OF EJECTION</b>  (0) NONE (1) PARTIAL (2) COMPLETE (7) EJECTED, DEGREE UNKNOWN (9) UNKNOWN IF EJECTED  <b>AREA OF EJECTION</b>  (01) WINDOW, LEFT SIDE (02) WINDOW, RIGHT SIDE (03) WINDOW, REAR (04) DOOR, LEFT SIDE (05) DOOR, RIGHT SIDE (06) DOOR, REAR OR TAILGATE (07) WINDSHIELD (08) ROOF OR OPEN CONVERTIBLE OR FROM EXTERNAL AREA (96) EJECTED AREA UNKNOWN (97) OTHER AREA: _____ (98) NOT APPLICABLE (NOT EJECTED) (99) UNKNOWN IF EJECTED	<div>0</div> <div>43</div>  <div>98</div> <div>44 45</div>
<b>IF OCCUPANT WAS EJECTED, DESCRIBE IN DETAIL BELOW:</b>  _____  _____  _____  _____			
		<b>HEAD RESTRAINT</b>  <b>HEAD RESTRAINT AVAILABLE FOR THIS POSITION</b>  (0) NOT EQUIPPED OR REMOVED (1) EQUIPPED (9) UNKNOWN	<div>0</div> <div>46</div>

# OCCUPANT INFORMATION OC-3

<p><b>OCCUPANT EYEWEAR</b></p> <p>(0) NONE  (1) GLASSES  (2) CONTACTS  (3) BOTH GLASSES AND CONTACTS  (4) OTHER _____  (8) NOT APPLICABLE  (9) UNKNOWN</p>	<p><u>2</u> 47</p>	<p><b>SOURCE OF INFORMATION</b></p> <p>(0) INTERVIEW  (1) HOSPITAL  (2) AUTOPSY  (3) POLICE  (4) OTHER _____  (5) LAY CORONER/EXTERNAL EXAM  (7) COMBINATION OF ABOVE (CIRCLE)  (8) NOT APPLICABLE  (9) UNKNOWN</p>	<p><u>0</u> 48</p>
--	------------------------	---	------------------------

## OCCUPANT INFORMATION OC-4

INDICATE LOCATION OF INJURIES.

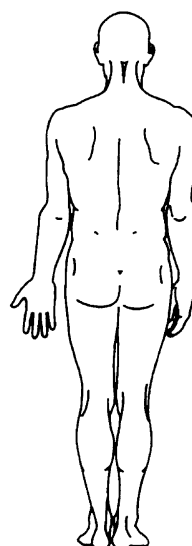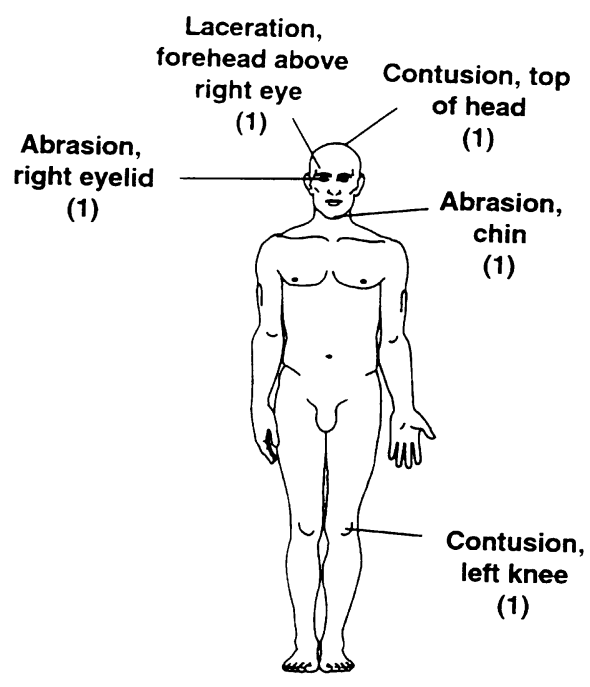

**NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.**

## OCCUPANT INJURY CLASSIFICATION

[illegible]

**NOTE: USE ADDITIONAL PAGES IF NECESSARY.**

## INJURY CLASSIFICATION IC-2

## CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

## FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (*X*)
- (55) MIDDLE INSTRUMENT PANEL (*Y*)
- (56) LOWER INSTRUMENT PANEL (*Z*)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (*ACRS*) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

## REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

## INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (*AIRBAG*)
- (47) AIRBAG (*ACRS*) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

## SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK
- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)
- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

## FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

## ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

## EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE  
(*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

## BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)


## PENETRATING OBJECTS

- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

## MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (*E.G. FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH",  
HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT

THE FIGURE BELOW  
IS AN EXPLANATION OF THE BODY REGION CODES  
LISTED ON PAGE IC - 4.

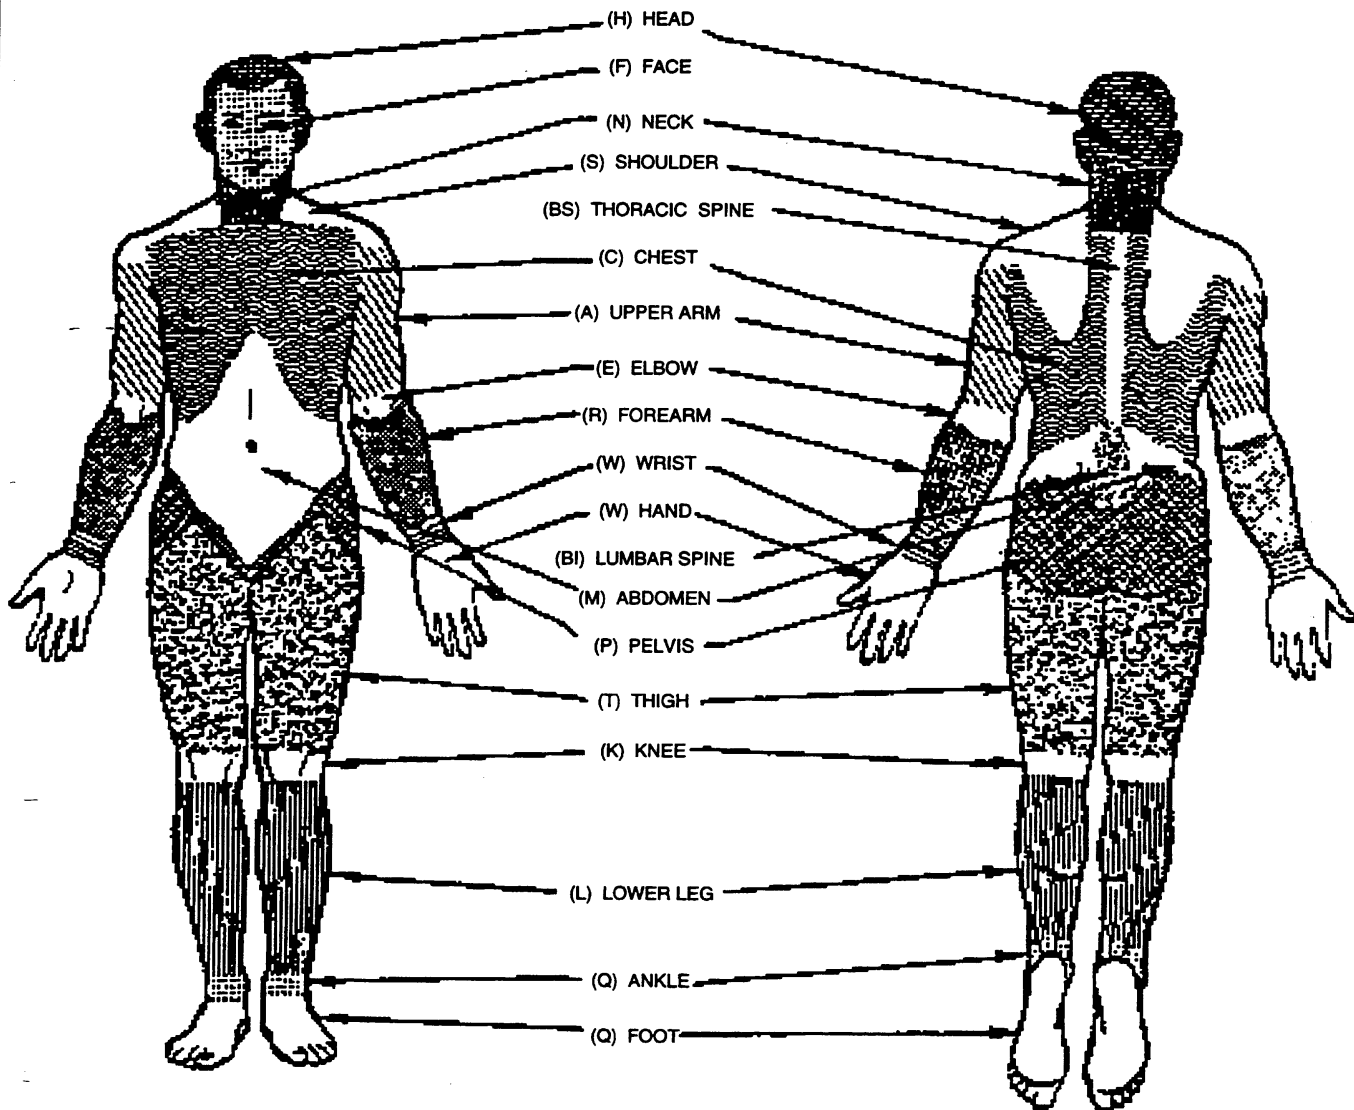

## CODES FOR OCCUPANT INJURY CLASSIFICATION (OIC)

**1 BODY REGION**

(H) HEAD/SKULL  
 (F) FACE  
 (N) NECK  
 (S) SHOULDER  
 (X) UPPER EXTREMITIES  
 (A) ARM (*UPPER*)  
 (E) ELBOW  
 (R) FOREARM  
 (W) WRIST/HAND  
 (C) CHEST  
 (M) ABDOMEN  
 (B) BACK  
 (P) PELVIC/HIP  
 (Y) LOWER EXTREMITIES  
 (T) THIGH  
 (K) KNEE  
 (L) LEG (*LOWER*)  
 (Q) ANKLE/FOOT  
 (O) WHOLE BODY  
 (U) UNKNOWN

**3 LESION**

(L) LACERATION  
 (C) CONTUSION  
 (A) ABRASION  
 (F) FRACTURE  
 (P) PERFORATION,  
 PUNCTURE  
 (K) CONCUSSION  
 (V) AVULSION  
 (R) RUPTURE  
 (S) SPRAIN  
 (D) DISLOCATION  
 (N) CRUSH  
 (M) AMPUTATION  
 (B) BURN  
 (G) DETACHMENT,  
 SEPARATION  
 (Z) FRACTURE AND  
 DISLOCATION  
 (T) STRAIN  
 (E) TOTAL SEVERANCE,  
 TRANSECTION  
 (O) OTHER  
 (U) UNKNOWN

**4 SYSTEM/ORGAN**

(S) SKELETAL  
 (V) VERTEBRAE  
 (J) JOINTS  
 (D) DIGESTIVE  
 (L) LIVER  
 (N) NERVOUS SYSTEM  
 (B) BRAIN  
 (C) SPINAL CORD  
 (E) EARS  
 (O) EYES  
 (A) ARTERIES  
 (H) HEART  
 (Q) SPLEEN  
 (G) UROGENITAL  
 (K) KIDNEYS  
 (R) RESPIRATORY  
 (P) PULMONARY/LUNGS  
 (M) MUSCLES  
 (T) THYROID, OTHER  
 ENDOCRINE GLAND  
 (I) INTEGUMENTARY (*SKIN*)  
 (W) ALL SYSTEMS IN REGION  
 (U) UNKNOWN

**2 ASPECT**

(R) RIGHT  
 (L) LEFT  
 (B) BILATERAL  
 (C) CENTRAL  
 (A) ANTERIOR/FRONT  
 (P) POSTERIOR/BACK  
 (S) SUPERIOR/UPPER  
 (I) INFERIOR/LOWER  
 (W) WHOLE REGION  
 (U) UNKNOWN

BODY REGION	ASPECT	LESION	SYSTEM/ORGAN	SEVERITY
1	2	3	4	5

**5 SEVERITY**  
(OR "AIS", ABBREVIATED INJURY SCALE)

(0) NONE  
 (1) MINOR  
 (2) MODERATE  
 (3) SERIOUS  
 (4) SEVERE  
 (5) CRITICAL  
 (6) MAXIMUM  
 (9) UNKNOWN



Duplicate columns 1-8  
from the previous card.

Module 0 C Format 0 2  
9 10 11 12

# OCCUPANT INFORMATION OC-1

## OCCUPANT IDENTIFICATION

OCCUPANT NUMBER

02  
13 14

ROLE OF OCCUPANT AT 1ST IMPACT

- (1) MOTOR VEHICLE DRIVER  
(2) MOTOR VEHICLE PASSENGER  
(NOT DRIVER)  
(9) UNKNOWN

2  
15

## PHYSICAL DESCRIPTION

AGE IN YEARS

- (00) LESS THAN 1 YEAR  
(98) 98 YEARS OR OLDER  
(99) UNKNOWN

16  
20 21

AGE IN MONTHS

- (00) LESS THAN 1 MONTH  
(25) 25 MONTHS OR OLDER  
(99) UNKNOWN

25  
22 23

MASS (kg)

- (999) UNKNOWN

(150 lb)

068  
24 25 26

HEIGHT (cm)

- (999) UNKNOWN

(6 ft, 0 in)

183  
27 28 29

SEX

- (1) MALE  
(2) FEMALE  
(9) UNKNOWN

1  
30

## OCCUPANT POSITION

ROW LOCATION

- (1) FRONT  
(2) SECOND  
(3) THIRD  
(4) FOURTH  
(7) OTHER: \_\_\_\_\_  
(8) EXTERNAL TO PASSENGER  
COMPARTMENT (E.G. BED OF PICKUP)  
(9) UNKNOWN

1  
16

LATERAL LOCATION

- (1) LEFT  
(2) LEFT CENTER  
(3) CENTER  
(4) RIGHT CENTER  
(5) RIGHT  
(6) ALL (LYING ON SEAT)  
(8) EXTERNAL TO PASSENGER  
COMPARTMENT  
(9) UNKNOWN

5  
17

POSTURE

- (10) SITTING ON SEAT  
(11) SITTING ON SEAT IN ABNORMAL  
POSITION (E.G. FEET ON DASH,  
SIDEWAYS)  
(12) SITTING ON CONSOLE  
(20) ON LAP OR IN ARMS  
(30) STANDING ON SEAT  
(40) STANDING ON FLOOR  
(47) STANDING, EXTERNAL TO  
PASSENGER COMPARTMENT  
(50) IN BASSINET  
(60) IN CHILD SEAT  
(65) IN CHILD HARNESS  
(70) LYING ON SEAT  
(80) LYING/SITTING ON PASSENGER  
FLOOR  
(83) LYING/SITTING ON OTHER  
OBJECT IN PASSENGER  
COMPARTMENT: \_\_\_\_\_  
(85) ON CARGO FLOOR/FOLDED  
SEAT-BACK  
(87) LYING/SITTING, EXTERNAL TO  
PASSENGER COMPARTMENT  
(97) OTHER: \_\_\_\_\_  
(99) UNKNOWN

10  
18 19

## MEDICAL CONDITIONS

TREATMENT/MORTALITY

- (00) NONE  
(01) FIRST AID AT SCENE  
(02) TREATED AT HOSPITAL/CLINIC  
BUT NOT ADMITTED  
(03) HOSPITALIZED FOR OBSERVATION  
LESS THAN 24 HOURS  
(04) HOSPITALIZED OVER 24 HOURS  
OR FOR SIGNIFICANT TREATMENT  
(05) FATAL, DEAD AT SCENE  
(06) FATAL, DOA  
(07) FATAL, DEAD WITHIN 24 HOURS  
(08) FATAL, DEAD 24 HOURS TO  
31 DAYS LATER  
(09) FATAL, DEAD 31 DAYS TO  
1 YEAR LATER  
(10) FATAL DEAD WITHIN UNKNOWN  
PERIOD  
(99) UNKNOWN

02  
31 32

INJURY SEVERITY SCORE (ISS)

- (99) UNKNOWN

06  
33 34

NON-IMPACT MED. CONDITIONS

- (0) NONE  
(1) YES, TIME & TYPE UNKNOWN  
(2) PRE-CRASH FATAL (CLINICAL  
DEATH AT WHEEL)  
(3) PRE-CRASH NON-FATAL (E.G.  
PRIOR INJURY, STROKE)  
(4) PREGNANT  
(5) POST-CRASH FATAL (DROWNING)  
(6) POST-CRASH NON-FATAL INJURY  
(7) OTHER: \_\_\_\_\_  
(8) COMBINATION OF ABOVE  
(CIRCLE EACH)  
(9) UNKNOWN

0  
35

# OCCUPANT INFORMATION OC-2

## MEDICAL CONDITIONS (CONT.)

### POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
- (1) C - POSSIBLE INJURY
- (2) B - NON-INCAPACITATING
- (3) A - INCAPACITATING INJURY
- (4) K - FATAL
- (5) INJURED, SEVERITY UNKNOWN
- (6) DIED PRIOR TO IMPACT
- (7) NON-FATAL INJURY,  
SEVERITY UNKNOWN
- (9) UNKNOWN

1  
36

## CHILD SEAT TYPE

- (00) NONE USED
- (01) YES, USED
- (02) INTEGRAL, Chrysler Mini-van
- (88) NOT APPLICABLE  
(ADULT OR OLDER CHILD)
- (99) UNKNOWN

88  
41 42

## CHILD SEAT MAKE/MODEL

---



---



---

## RESTRAINT SYSTEM

### ACTIVE RESTRAINT SYSTEM

- (0) NONE
- (1) LAP BELT
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &  
SHOULDER HARNESS
- (9) UNKNOWN

3  
37

### ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
- (1) LAP BELT ONLY
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &  
SHOULDER HARNESS
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NONE AVAILABLE)
- (9) UNKNOWN

0  
38

### PASSIVE RESTRAINT SYSTEM

- (0) NONE
- (1) AIRBAG INSTALLED
- (2) PASSIVE UPPER TORSO  
WITH KNEE BOLSTERS
- (3) PASSIVE UPPER TORSO  
WITHOUT KNEE BOLSTERS
- (4) PASSIVE LAP & UPPER TORSO
- (5) AIRBAG INSTALLED &  
PASSIVE RESTRAINT
- (7) OTHER: \_\_\_\_\_
- (9) UNKNOWN

1  
39

### PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
- (1) AIRBAG NOT DEPLOYED
- (2) AIRBAG DEPLOYED
- (3) AIRBAG NOT REINSTALLED
- (4) PASSIVE UPPER TORSO USED
- (5) PASSIVE LAP & UPPER TORSO USED
- (6) SYSTEM USED IN MANUAL MODE
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NOT ORIGINALLY  
EQUIPPED)
- (9) UNKNOWN

2  
40

## EJECTION

### DEGREE OF EJECTION

- (0) NONE
- (1) PARTIAL
- (2) COMPLETE
- (7) EJECTED, DEGREE UNKNOWN
- (9) UNKNOWN IF EJECTED

0  
43

### AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
- (02) WINDOW, RIGHT SIDE
- (03) WINDOW, REAR
- (04) DOOR, LEFT SIDE
- (05) DOOR, RIGHT SIDE
- (06) DOOR, REAR OR TAILGATE
- (07) WINDSHIELD
- (08) ROOF OR OPEN CONVERTIBLE OR  
FROM EXTERNAL AREA
- (96) EJECTED AREA UNKNOWN
- (97) OTHER AREA: \_\_\_\_\_
- (98) NOT APPLICABLE (NOT EJECTED)
- (99) UNKNOWN IF EJECTED

98  
44 45

### IF OCCUPANT WAS EJECTED, DESCRIBE IN DETAIL BELOW:

---



---



---



---

## HEAD RESTRAINT

### HEAD RESTRAINT AVAILABLE FOR THIS POSITION

- (0) NOT EQUIPPED OR REMOVED
- (1) EQUIPPED
- (9) UNKNOWN

1  
46

# OCCUPANT INFORMATION OC-3

## OCCUPANT EYEWEAR

- (0) NONE
- (1) GLASSES
- (2) CONTACTS
- (3) BOTH GLASSES AND CONTACTS
- (4) OTHER \_\_\_\_\_
- (8) NOT APPLICABLE
- (9) UNKNOWN


0  
47

## SOURCE OF INFORMATION

- (0) INTERVIEW
- (1) HOSPITAL
- (2) AUTOPSY
- (3) POLICE
- (4) OTHER \_\_\_\_\_
- (5) LAY CORONER/EXTERNAL EXAM
- (7) COMBINATION OF ABOVE (CIRCLE)
- (8) NOT APPLICABLE
- (9) UNKNOWN

0  
48

INDICATE LOCATION OF INJURIES.

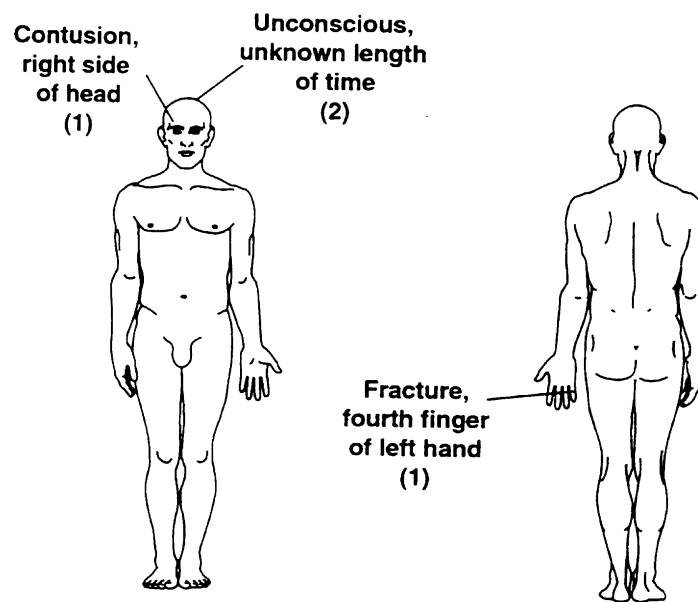

INJURY CLASSIFICATION IC-1

## OCCUPANT INJURY CLASSIFICATION

**Duplicate "Occupant Number" for each line.**

57

## CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

## FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (X)
- (55) MIDDLE INSTRUMENT PANEL (Y)
- (56) LOWER INSTRUMENT PANEL (Z)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

## REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

## INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (*AIRBAG*)
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

## SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK
- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)
- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

## FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

## ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

## EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

## BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)

## PENETRATING OBJECTS

- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

## MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (E.G. *FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT






[illegible]

1998, 1999, 2000, 2001, 2002, 2003, 2004, 2005, 2006, 2007, 2008, 2009, 2010, 2011, 2012, 2013, 2014, 2015, 2016, 2017, 2018, 2019, 2020, 2021, 2022, 2023, 2024, 2025, 2026, 2027, 2028, 2029, 2030, 2031, 2032, 2033, 2034, 2035, 2036, 2037, 2038, 2039, 2040, 2041, 2042, 2043, 2044, 2045, 2046, 2047, 2048, 2049, 2050, 2051, 2052, 2053, 2054, 2055, 2056, 2057, 2058, 2059, 2060, 2061, 2062, 2063, 2064, 2065, 2066, 2067, 2068, 2069, 2070, 2071, 2072, 2073, 2074, 2075, 2076, 2077, 2078, 2079, 2080, 2081, 2082, 2083, 2084, 2085, 2086, 2087, 2088, 2089, 2090, 2091, 2092, 2093, 2094, 2095, 2096, 2097, 2098, 2099, 2100, 2101, 2102, 2103, 2104, 2105, 2106, 2107, 2108, 2109, 2110, 2111, 2112, 2113, 2114, 2115, 2116, 2117, 2118, 2119, 2120, 2121, 2122, 2123, 2124, 2125, 2126, 2127, 2128, 2129, 2130, 2131, 2132, 2133, 2134, 2135, 2136, 2137, 2138, 2139, 2140, 2141, 2142, 2143, 2144, 2145, 2146, 2147, 2148, 2149, 2150, 2151, 2152, 2153, 2154, 2155, 2156, 2157, 2158, 2159, 2160, 2161, 2162, 2163, 2164, 2165, 2166, 2167, 2168, 2169, 2170, 2171, 2172, 2173, 2174, 2175, 2176, 2177, 2178, 2179, 2180, 2181, 2182, 2183, 2184, 2185, 2186, 2187, 2188, 2189, 2190, 2191, 2192, 2193, 2194, 2195, 2196, 2197, 2198, 2199, 2200, 2201, 2202, 2203, 2204, 2205, 2206, 2207, 2208, 2209, 2210, 2211, 2212, 2213, 2214, 2215, 2216, 2217, 2218, 2219, 2220, 2221, 2222, 2223, 2224, 2225, 2226, 2227, 2228, 2229, 2230, 2231, 2232, 2233, 2234, 2235, 2236, 2237, 2238, 2239, 2240, 2241, 2242, 2243, 2244, 2245, 2246, 2247, 2248, 2249, 2250, 2251, 2252, 2253, 2254, 2255, 2256, 2257, 2258, 2259, 2260, 2261, 2262, 2263, 2264, 2265, 2266, 2267, 2268, 2269, 2270, 2271, 2272, 2273, 2274, 2275, 2276, 2277, 2278, 2279, 2280, 2281, 2282, 2283, 2284, 2285, 2286, 2287, 2288, 2289, 2290, 2291, 2292, 2293, 2294, 2295, 2296, 2297, 2298, 2299, 2300, 2301, 2302, 2303, 2304, 2305, 2306, 2307, 2308, 2309, 2310, 2311, 2312, 2313, 2314, 2315, 2316, 2317, 2318, 2319, 2320, 2321, 2322, 2323, 2324, 2325, 2326, 2327, 2328, 2329, 2330, 2331, 2332, 2333, 2334, 2335, 2336, 2337, 2338, 2339, 2340, 2341, 2342, 2343, 2344, 2345, 2346, 2347, 2348, 2349, 2350, 2351, 2352, 2353, 2354, 2355, 2356, 2357, 2358, 2359, 2360, 2361, 2362, 2363, 2364, 2365, 2366, 2367, 2368, 2369, 2370, 2371, 2372, 2373, 2374, 2375, 2376, 2377, 2378, 2379, 2380, 2381, 2382, 2383, 2384, 2385, 2386, 2387, 2388, 2389, 2390, 2391, 2392, 2393, 2394, 2395, 2396, 2397, 2398, 2399, 2400, 2401, 2402, 2403, 2404, 2405, 2406, 2407, 2408, 2409, 2410, 2411, 2412, 2413, 2414, 2415, 2416, 2417, 2418, 2419, 2420, 2421, 2422, 2423, 2424, 2425, 2426, 2427, 2428, 2429, 2430, 2431, 2432, 2433, 2434, 2435, 2436, 2437, 2438, 2439, 2440, 2441, 2442, 2443, 2444, 2445, 2446, 2447, 2448, 2449, 2450, 2451, 2452, 2453, 2454, 2455, 2456, 2457, 2458, 2459, 2460, 2461, 2462, 2463, 2464, 2465, 2466, 2467, 2468, 2469, 2470, 2471, 2472, 2473, 2474, 2475, 2476, 2477, 2478, 2479, 2480, 2481, 2482, 2483, 2484, 2485, 2486, 2487, 2488, 2489, 2490, 2491, 2492, 2493, 2494, 2495, 2496, 2497, 2498, 2499, 2500, 2501, 2502, 2503, 2504, 2505, 2506, 2507, 2508, 2509, 2510, 2511, 2512, 2513, 2514, 2515, 2516, 2517, 2518, 2519, 2520, 2521, 2522, 2523, 2524, 2525, 2526, 2527, 2528, 2529, 2530, 2531, 2532, 2533, 2534, 2535, 2536, 2537, 2538, 2539, 2540, 2541, 2542, 2543, 2544, 2545, 2546, 2547, 2548, 2549, 2550, 2551, 2552, 2553, 2554, 2555, 2556, 2557, 2558, 2559, 2560, 2561, 2562, 2563, 2564, 2565, 2566, 2567, 2568, 2569, 2570, 2571, 2572, 2573, 2574, 2575, 2576, 2577, 2578, 2579, 2580, 2581, 2582, 2583, 2584, 2585, 2586, 2587, 2588, 2589, 2590, 2591, 2592, 2593, 2594, 2595, 2596, 2597, 2598, 2599, 2600, 2601, 2602, 2603, 2604, 2605, 2606, 2607, 2608, 2609, 2610, 2611, 2612, 2613, 2614, 2615, 2616, 2617, 2618, 2619, 2620, 2621, 2622, 2623, 2624, 2625, 2626, 2627, 2628, 2629, 2630, 2631, 2632, 2633, 2634, 2635, 2636, 2637, 2638, 2639, 2640, 2641, 2642, 2643, 2644, 2645, 2646, 2647, 2648, 2649, 2650, 2651, 2652, 2653, 2654, 2655, 2656, 2657, 2658, 2659, 2660, 2661, 2662, 2663, 2664, 2665, 2666, 2667, 2668, 2669, 2670, 2671, 2672, 2673, 2674, 2675, 2676, 2677, 2678, 2679, 26

1000

Logan, Christopher, and Mark Longenecker.

1. [Introduction](#)

Year	1990	1995	2000
1990	1990	1995	2000

**Abstract**

100





PN21000 #2





PN 21000 #3



PN 21000 #4



PN 21000 #5



PN 21000 #8




PN 21000 #7



PN 21000 #8



**PN21000#9**

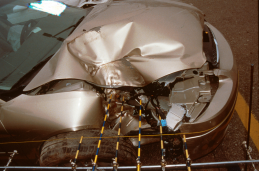

PN21000 #10





PN 21000 #11  
Best Available



PN21000#12




PN 21000 #13



PN21000#14



PN21000#15

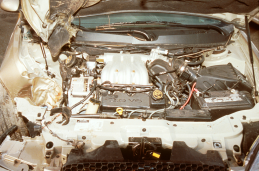

PN21000#16



PN 21000 #17




PN 21000 #18





PN 21000 #19

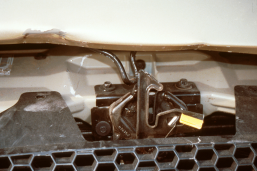

PN 21000 #20



PN 21000 #21



**PN 21000 #22**



**PN 21000#23**



PN 21000 #24



**PN 21000 #25**  
**Best Available**



**PN 21000 #26**  
**Best Available**





**PN 21000 #27**  
**Best Available**



PN 21000 #28  
Best Available



**PN 21000 #29**  
**Best Available**



**PN 21000 #30**  
**Best Available**



PN 21000 #31



PN 21000 #32



PN 21000 #33



PN 21000 #34





PN 21000 #35



PN 21000 #36



PN 21000#37




PN 21000 #38



PN 21000 #39



PN 21000#40

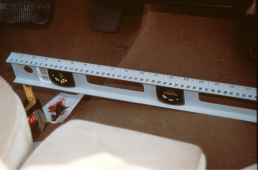

**PN 21000 #41**  
**Best Available**



**PN 21000 #42**  
**Best Available**





**PN 21000 #43**  
**Best Available**



PN 21000 #44



PN 21000 #45



PN 21000 #46



PN 21000 #47



PN 21000 #48




PN21000 #49



**PN 21000 #50**



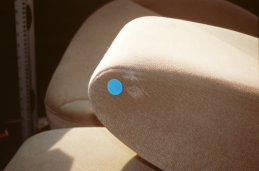

PN21000#51



PN 21000#52



PN 21000 #53




PN 21000 #54



PN 21000 #55



PN 21000 #58

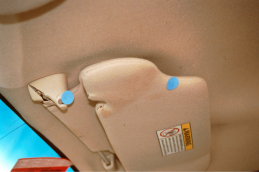

PN 21000 #57



PN21000#58





**PN 21000 #59**



**PN 21000 #60**



PN 21000 #61



PN 21000 #82



PN 21000 #63



PN 21000 #64



PN 21000 #65

CASE NO: 210-08

CASE NAME: John Ford

TYPE: Taurus SE, 4-door sedan

OCCUPANT: Driver, 38-year-old male

STATURE: 178 cm (5 ft, 10-in) ht; 104 kg (230 lb) wt

RESTRAINTS: 3-point belt and energy front-impact  
airbag deployed; pretensioner did not fire

SEVERITY: MAJ -1 / MIN -1





CASE NO.: 210-00

CASE VEHICLE: 2008 Ford

TYPE: Taurus SE, 4-door sedan

OCCUPANT: Right front, 16-year-old male

STATURE: 163 cm (5'4.0 in) MASS: 68 kg (150 lb)

RESTRAINTS: 3-point belt, 2nd row, frontal impact  
airbag deployed, pretensioner not active

SEVERITY: MAIS - 2      ISS - 8

